
	<u> </u>	KUMI			*2	<u>921332</u> *	ROY 1 2 101 145
			RATIONS CO	NTROL			υs
	Wad Number		SITE	Elem CD E	nd Item	THE INDESTRUCTION	
•	S6444-J02-R0	91	LCC	1 1	105 FLT: 017	DATE	: 11/09/2001 : 13:01:33
	Title: SSV ICE AND	DEBRIS ASSE	ESSMENT	. L		IIME	Sub Element/Zone
(****)	Project Work Order No.		Hazard:	SFOC Sa	7.	Local Co	· •
10° 4 1 330	Authorizing Document		Material & Eq	<u></u>	MICR Reg'd NOV 1	 '	oom Copy
Aco.	ORB517-263((ad			Yes	2 0:	
			Yes	No		□ No ☑ Yes	□ No
			PEHF	ORM THE FOL			
	Pre-Ops Setups Operation Task Number	<u>Seq</u>	<u>Steps</u>	Task Constant	Operation USA VALON USA VM VM VM VM VM VM VM VM VM VM	Steps	
	OPS Support			1			
	Task Number	<u>Seq</u>	Steps	<u>Task</u>	Operation Number Seq	Steps	
gorma.							
	Operating Instruction	ons					
	Task		Steps	<u>Tas</u>	<u>Seq</u>	Steps	
		010 015 020 030 040 050 060			080 090 100 110 120 130 140		
USA VM	Post Ops Operation				Appendices		
005	Operation Task Number	<u>Seg</u>	Steps			ē₫	
Ago Ag					N/A		
(r							
L	Subtask WAD's N/A				<u> </u>		
	Planner	WC	Ext	QC Closure	(\$P\$C)	Date	Page
	LISA RUTKOWSKI	160	0746		440	MEC 14 AU	2
	USA 32-82 New 03-99 (F)out)			······			<u> </u>

*2921332 *


		NG SHEET	NTROL				
Wad Number \$6444-J02-R01		SITE LCC	Elem CD V	End Item 105 FLT: 0	017	DATE: TIME:	11/09/2001 13:01:33
Title: SSV ICE AND D	EBRIS ASSE	SSMENT.				į į	Sub Element/Zone 30
Project Work Order No.		Hazard: X Yes No		TOTAL TBOC	DK USA	Local Copy Firing Room	
Authorizing Document ORB517-263(AD	D)	Material & Equ	uipment:	MICR Req'd	NOV 12 '01	OMRS:	□ No
		PERFO	ORM THE FO	LLOWING:			
Pre-Ops Setups Operation Task Number	Seq S	<u>Steps</u>	<u>Tas</u> :	Operation k Number	<u>Seg</u>	Steps	
ODO Dunnast							
OPS Support Operation Task Number S	Seg <u>S</u>	<u>Steps</u>	<u>Tas</u>	Operation k Number	<u>Şeq</u>	<u>Stepş</u>	
Operating Instruction	19						
Task 5	_	<u>Steps</u>	<u>Ta</u> s	<u>sk</u>	<u>Seq</u>	Steps	
Post Ops				Ann	endices		
Operation Task Number S	Seq Si	Steps		1	Task Seq N/A		
Subtask WAD's							,
Planner		Ext	QC Closure		Date		Page
LISA RUTKOWSKI	WC 150 USA NOV 12 '01	0746		0490	(E)	0EC 1 4 TO1	2 _{OF} 2

OMI TASK CLOSEOUT CHECKLIST

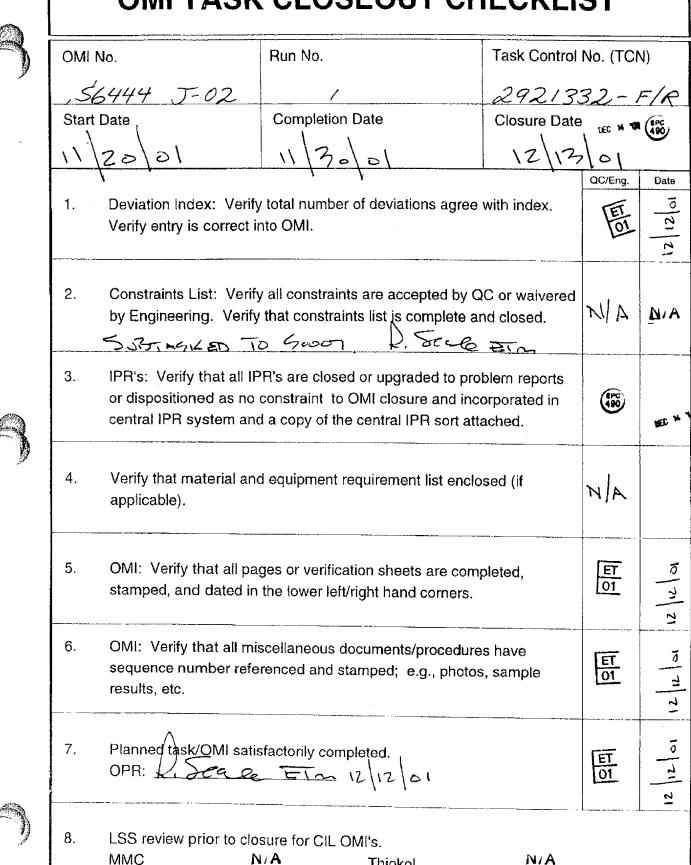

_____ Thiokol



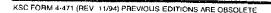

SSV ICE AND DEBRIS ASSESSMENT

Element/End Item: ALL

Flow/Usage: ET-103 & SUBS

Facility: LC 39

Design Center Concurrence: MSFC/JSC

Category: B
OPR: ETM
TTL ORG: SE

This document contains HAZARDOUS operations.

Table of Contents:

1.0 INFORMATION	1
1.1 Objective	
1.2 Special Instructions All Operations	
1.3 Operations List	Δ
2.0 SAFETY INFORMATION	5
2.1 Hazards	5
2.2 Safety Requirements	5
2.4 Reference Safety Documentation	
3.0 STAGING REQUIREMENTS	6
3.1 Referenced Engineering Documentation	6
3.1.2 Documents	
3.2 Parts, Materials, Equipment, and Special Tools	6
3.2.5 Shop Support Materials	
3.2.8 Personal Protective Equipment	
4.0 PLANNING REQUIREMENTS	8
4.3 LPS Requirements	8
4.3.1 Computer Systems	8
4.4 Support Services, Commodities, and Equipment	8
4.4.2 Communications	8
4.4.3 OTV	
4.4.4 Countdown Display/Status	9
4.4.8 Services	
4.4.12 Propellants, Gases and Chemicals	9
5.0 CONFIGURATION ACCOUNTING AND VERIFICATION	10
5.1 Specific OMRS Requirements Satisfied by this TOP	10
5.5 List of References	

1.0 INFORMATION

1.1 Objective

Provide necessary tasks that document, monitor and evaluate ice and debris conditions to eliminate or minimize debris concerns of the integrated SSV during ET tanking, FRF, launch, and associated detanking.

Description

- 1. This OMI is performed as subtask to S0007/S0014/S0037.
- 2. This OMI provides documentation of ice/debris activities:
 - A. Pre-launch icing briefing
 - B. Pre-launch debris inspection
 - Countdown Based timeline evaluation monitoring of ET TPS surfaces using OTV
 - D. OTV monitoring of seal/flange areas for cryogenic leakage
 - E. SSV OTV monitoring for debris conditions during countdown
 - F. Cryogenic replenish inspection for evaluation of SSV and facility debris concerns or anomalies
 - G. Evaluation of concerns/anomalies in the event of ET detanking
 - H. Review of engineering film data for SSME ignition, launch, ascent, ET separation, and orbiter landing.
- 3. Orbiter landing debris information is contained in the NASA publication for Ice and Debris Assessment. That report is referenced in this OMI for continuity of debris data.

1.2 Special Instructions All Operations

- 1. This OMI is run as a subtask to OMI's S0007, S0014, and S0037. All PAD clearing and controlled access operations will be performed per those OMI's.
- 2. Constraints will be statused by controlling OMI's \$0007/\$0014/\$0037.
- 3. The OTV camera numbering scheme for PAD A/B is 0XX/1XX.
- 4. Task Team Leader assignment: NASA PH-H is TTL for L-20 Hour Walkdown, Final Inspection, and Post Launch/Drain Walkdown. ETM is TTL for all other operations.
- 5. From time stable replenish mode starts until start of final SCAN, scanning with individual cameras should be performed approximately once per hour.
- 6. Cameras 061/161, 063/163, and 070/170 may be released to NASA select with CICE concurrence.
- 7. All personnel participating in final inspection and post drain walkdown shall be current in following training:
 - A. Emergency PAD egress
 - B. Fire fighting
 - C. ELSA
- 8. Milestones:
 - A. MLP portion of post launch walkdown commences at approximately T + 1 hours.
 - B. PAD acreage portion of the post launch walkdown commences at approximately T + 2 hours. (may be deferred until preferred daylight hours.)
 - C. Post drain walkdown commences at approximately T + 4 hours after drain initiated (typically 1 1/2 hours after LH₂/LO₂ low level sensors dry).
- 9. Hands-on investigation required for all ET-TPS defects suspected of violating NSTS 08303 ice/debris inspection criteria.
- 10. From time launch scrub is declared until 1.5 hours past time LH₂/LO₂ low level sensors read dry, OTV camera scanning shall be performed approximately once per hour.

- 11. OTV cameras 004/104, 009/109, 013/113, 033/133, 042/142, 054/154, 055/155, 056/156, 060/160, 061/161, 062/162, 063/163, 064/164, 065/165, 066/166, 067/167, 068/168, 069/169, 070/170, and 071/171 shall be used to monitor LO₂/LH₂ tank drain operations.
- 12. Excessive vapors are defined as being more severe than that described in NSTS 08303 Ice/Debris Inspection Criteria or NSTS 16007 Launch Commit Criteria Hazardous Gas Subsystem.
- 13. Quality coverage is not required for performance of this OMI. Ref SFOC-GO0007, Ice and Debris Team Operations are exempt from quality coverage. The ROR (CTIF) performs the CMQC function for all non-hazardous operations.
- 14. Personnel using Sony DKC-ID1 camera shall verify lithium ion battery is securely locked in the bayonet fitting and the lithium button battery door is securely locked and taped in place.
- 15. Verify camera flash is deactivated.
- 16. Personnel using Kodak DC 50/120 camera shall verify alkaline batteries are properly installed.
- 17. Personnel using digital cameras shall not operate in H_2 leak or O_2 rich environment (23 percent or greater).
- 18. Personnel using the Sony MVC-FD91 camera shall verify the lithium ion battery is securely locked and the battery door is locked closed. Personnel shall verify that both battery doors (lithium ion and lithium button) are closed and taped shut.
- 19. Personnel shall verify that cameras and equipment are securely tethered when at the PAD while the SSV is present.

1.3 Operations List

	Operation	Shop/ Cntl Rm Console	OPR	Haz (Y/N)	Duration (Hrs)
No.	Title				
10	Support Preparations	STM/ FR2	ETM	N	0.2
15	IR Camera Setup	PH-H/ NA	ETM	N	4.0
20	Ice Prediction Briefing	SE/ NA	ETM	N	0.5
30	Pre-launch Walkdown	SE/ NA	ETM	N	2.0
40	Ice Frost Debris Console Initial Configuration Setup	SE/ FR2	ETM	N	3.0
50	SSV Debris Assessment	SE/ FR2	ETM	N	18.0
60	Group 1 Monitoring LO2 Chill Down Thru T-0	SE/ FR2	ETM	N	15.0
70	Group 2 Monitoring - LH2 Chill Down Thru T-0	SE/ FR2	ETM	N	15.0
80	Final Inspection	SE/ FR2	ETM	Y	3.0
90	LO2/LH2 Drain Monitoring	SE/ FR2	ETM	N	4.0
100	Console Securing	SE/ FR2	ЕТМ	N	0.5
110	Summary Tape	SE/ FR2	ETM	N	18.0
120	Post Drain Walkdown	SE/ NA	ETM	Y	2.0
130	Post Launch Walkdown	SE/ NA	ETM	Y	3.0
140	Film Review	SE/ NA	ETM	N	15.0
145	IR Camera Removal	PH-H/ NA	ETM	N	2.0
150	Final Report	SE/ NA	ETM	N	0.5

2.0 SAFETY INFORMATION

2.1 Hazards

Operation

- 1. Working at unprotected heights.
- 2. Walkdown at PAD while SSV is in stable replenish mode.

2.2 Safety Requirements

Operation

- If lightning activity is forecast to be within 5 miles of launch PAD, CTC and SFOC safety shall implement provisions of adverse/severe weather and lightning policy contained in GSOP 5400 Ground Safety Operations Procedures.
- 2. There are no safing/shutdown or evacuation steps required in this OMI.
- 3. Hazardous operations within this subtask OMI will not be started until safety concurrence to proceed has been given per the integrated OMI controlling this subtask.

2.4 Reference Safety Documentation

Number	Rev	Title
KHB 1710.2	LI	KSC Safety Practices Handbook
GSOP 5400	LI	Ground Safety Operating Procedures

3.0 STAGING REQUIREMENTS

3.1 Referenced Engineering Documentation

3.1.2 Documents

OPERATION 120

Document No.

Rev

Title

NSTS 08303

(LI)

NSTS PROGRAM ICE/DEBRIS

INSPECTION CRITERIA

3.2 Parts, Materials, Equipment, and Special Tools

3.2.5 Shop Support Materials

OPERATION 15	Nowandata	04	¥1.
Part No./Find No.	Nomenclature	Qty	Unit
8305-00-519-3144	Rymple cloth	2	roll
6810-00-543-7915	Isopropyl alcohol	8	ounces
OPERATION 145			
Part No./Find No.	Nomenclature	Qty	Unit
8305-00-519-3144	Rymple cloth	2	roll
6810-00-543-7915	Isopropyl alcohol	8	ounces
6505-00-133-8025	Petroleum Jelly, Vaseline (or equivalent)	1	tube/jar

3.2.8 Personal Protective Equipment

OPERATION 15 Nomenclature

> N-Dex nitril gloves chemical splash goggles

face shield

OPERATION 30 Nomenclature

safety harness

lanyard

OPERATION 80 Nomenclature

safety harness

lanyard

Nomex coveralls with gloves and hoods

ELSA

OPERATION 120 Nomenclature

safety harness

lanyard hardhats

flame retardant coveralls

OPERATION 130 Nomenclature

safety harness

lanyard hardhats

flame retardant coveralls

OPERATION 145 Nomenclature

> N-Dex nitril gloves chemical splash goggles

face shield

4.0 PLANNING REQUIREMENTS

OIR Required Yes [], No [X]

4.3 LPS Requirements

4.3.1 Computer Systems

PC GOAL CCMS Configuration CDS CMS

4.4 Support Services, Commodities, and Equipment

4.4.2 Communications

(Per controlling OMI S0007, S0014 or S0037 unless specified otherwise)

4.4.3 OTV

(Per controlling OMI S0007, S0014 or S0037 unless specified otherwise)

OTV Cameras required: 004/104, 009/109, 013/113, 033/133, 042/142, 054/154, 055/155, 056/156, 060/160, 061/161, 062/162, 063/163, 064/164, 065/165, 066/166, 067/167, 068/168, 069/169, 070/170, and 071/171

OTV Cameras to be recorded: 004/104, 009/109, 013/113, 033/133, 042/142, 054/154, 055/155, 056/156, 060/160, 061/161, 062/162, 063/163, 064/164, 065/165, 066/166, 067/167, 068/168, 069/169, 070/170, and 071/171

4.4.4 Countdown Display/Status

Display Required	Bldg	Room	Operation Time
Timing	LCC	FR2	Duration of Test
Countdown and GMT	rcc	FR2	Duration of Test

4.4.8 Services

Service/Special Requirements	Location	Purpose
SFOC Safety	LC-39 A&B	Safety Support
ELSA'S (8)	LC-39 A&B	Inspection Team Use
Radio Net 105	LC-39 A&B	Inspection Team Use

4.4.12 Propellants, Gases and Chemicals

Commodity	Spec No.	Quantity	Revr	Location	Minimum Press	<u>Delivery</u> <u>Time</u>
GN₂	SES-0073 -6.3-5	* -	РН-Н 861-3645	Pad 39B Camera Site 2	3000 PSI	l week prior to T-0

5.0 CONFIGURATION ACCOUNTING AND VERIFICATION

5.1 Specific OMRS Requirements Satisfied by this TOP

OMRS NO.	NOMENCLATURE/ EFFECTIVITY	SEQ-STEP (CAP)
S00E00.021	ET TPS MON DURING DETANK TAF;C	90-005
S00E00.031	POST DETANK ET TPS INSPECT TAF;C	120-002
	PRELAUNCH WEATHER BRIEFING (L-1 DAY) VAF1-90	20-001
	ET TPS SURFACE MONITCRING T23,27-29,31-999	50-022
	MONITOR GO2 VENT HOOD VAF1-90	50-024
	MONITOR ET/ORB MPS FCR LEAKAGE VAF1-90	50-022
SC0L00.150	HIGH WIND ET NOSE INSPECTION SAF; C	50-020
	POST LAUNCH SHUTTLE/PAD AREA INSPECTION SAF1-999	130-002
\$00009.011 (1)	ENGR REVIEW & ANALYSIS OF LAUNCH FILM SAF1-999	140-001
	AN ENGINEERING PAD INSPECTION TEAM SAF1-999	80-002
	INSPECT ORBITER AFT ENGINE SAF1-999	80-002
	INFRARED SURVEILLANCE SAF1-999	80-002
\$00000.030 (1)	PRELAUNCH SHUTTLE/PAD AREA INSPECTION SAF1-999	30-001

09-01-2001 APPROVED

OMI S6444 J02 APPROVED

5.5 List of References

OPERATION 20	~	COLUMN TO THE CO
Reference No.	Rev	Title
NSTS 16007	(LI)	NSTS Program Launch Commit Criteria - Hazardous Gas
		Subsystem and Appendix F
OPERATION 30		· · · · · · · · · · · · · · · · · · ·
Reference No.	Rev	Title
80901019010	(LI)	ET Post Build Acceptance and In-Process Rework
		Requirements Manual - Offsite
OPERATION 40		
Reference No.	Rev	Title
79K24576	(LI)	OTV System Installation, LC 39, Pad A
79K24522	(LI)	OTV System Installation, LC 39, Pad B
OPERATION 50		
Reference No.	Rev	Title
SPI SP-519	(LI)	OMI and OM Implementation
SFOC GO0007	(LI)	Quality Planning Requirements Document (OPRD)

OPERATION 10 Support Preparations

Shop: STM

Cntrl Rm Console: FR2

OPR: ETM Zone: NA

Hazard (Y/N): N Duration (Hrs): 0.2

10-1 STM JYVO 138

Verify PAD OTV system is configured to support S6444 as scheduled.

Support: COMM

10-2 STM JSTC 111 JSTC *SCB 114

Verify eight 10-minute ELSA's available at complex J for use by Final Inspection Team (ref S0007/S0014/S0037).

Support: LS

10-3 STM TBC 136

Operation - Support Preparations complete.

*** End of Operation 10 ***



OPERATION 15 IR Camera Setup

Shop: PH-H

Cntrl Rm Console: NA

OPR: ETM Zone: NA

Hazard (Y/N): N Duration (Hrs): 4.0

WARNING

Hard hats required on the Pad when SSV is not present.

CAUTION

Exercise care to avoid dropping equipment, fasteners, etc from RSS Roof to prevent damage to equipment or injury to personnel. All tools must be tethered.

NOTE

IR Camera installation at RSS Roof site may be not performed if IR Camera already installed or if technical concerns preclude such.

15-1 Install IR camera at RSS Roof Site as follows.

- 1. Rotate camera housing back cover to open position by removing bolts with flat washers (20 pl). Retain bolts/washers for reinstallation.
- 2. Remove camera housing front cover by removing fasteners (2 pl).

 Reinstall fasteners after cover removal. Retain cover for reinstallation after IR Camera Unit removal.
- 3. Install IR Camera Unit into camera housing. Secure IR Camera Unit in housing by locking spring pin at lower, left.



WARNING

Power cable is live. Care should be exercised when connecting power cable to avoid electric shock.

CAUTION

Do NOT allow opened back cover to exert undue force on cables once cables have been connected.

4. Connect:

- OTV coaxial cable
- Pan & tilt cable
- Controller cable
- Power cable
- 5. Rotate camera housing back cover into closed position. Secure back cover by installing bolts/flat washers (20 pl). Tighten bolts wrench tight.

ET 124/21

WARNING

Isopropyl Alcohol is flammable and is a skin, eye and respiratory tract irritant that affects the central nervous system. Ensure adequate ventilation, avoid inhalation of vapors and do not use near heat, sparks or open flame. Skin contact may cause redness and pain eye contact will cause severe eye irritation and may result in permanent damage. Inhalation of vapors in high concentrations has a narcotic effect on the central nervous system. Personnel shall wear N-Dex nitril gloves and chemical splash goggles. When working at eye level or above wear a face shield over goggles.

WS002.a 05-22-01

- 6. Clean IR Camera Unit lens plate using (1) roll 8305-00-519-3144 Rymple cloth dampened with (4) ounces 6810-00-543-7915 Isopropyl alcohol.
- 7. **Perform** functional checkout of IR Camera Unit using local controller if required at Task Team Leader (TTL) discretion.

Sub Step Not Performed:

11/2/01

NASA PH-H

USA ETM K Brew

Date_

Not Performed: NA



NOTE

IR Camera installation at Camera Site 2 may be not performed if IR Camera already installed or if technical concerns preclude such.

15-2 Install IR camera at Camera Site 2 as follows.

- 1. Rotate camera housing back cover to open position by removing eight ea bolts using Phillips screwdriver. Retain bolts/washers for reinstallation.
- 2. Remove camera housing front cover by removing securing bolt(s). Reinstall bolt(s) after cover removal. Retain cover for reinstallation after IR Camera Unit removal.
- 3. Install IR Camera Unit into camera housing. Secure IR Camera Unit in housing by tightening set screw(s) wrench tight at lower left/right.

WARNING

Power cable is live. Care should be exercised when connecting power cable to avoid electric shock.

4. Connect:

- OTV coaxial cable
- Pan & tilt cable
- Controller cable (2 pl)
- Power cable
- 5. Rotate camera housing back cover into closed position. Secure back cover by installing bolts (8 pl). Tighten bolts using Phillips screwdriver.



WARNING

Isopropyl Alcohol is flammable and is a skin, eye and respiratory tract irritant that affects the central nervous system. Ensure adequate ventilation, avoid inhalation of vapors and do not use near heat, sparks or open flame. Skin contact may cause redness and pain eye contact will cause severe eye irritation and may result in permanent damage. Inhalation of vapors in high concentrations has a narcotic effect on the central nervous system. Personnel shall wear N-Dex nitril gloves and chemical splash goggles. When working at eye level or above wear a face shield over goggles.

WS002.a 05-22-01

- 6. Clean IR Camera Unit lens plate using (1) roll 8305-00-519-3144 Rymple cloth dampened with (4) ounces 6810-00-543-7915 Isopropyl alcohol.
- 7. **Perform** functional checkout of IR Camera Unit using local controller if required at Task Team Leader (TTL) discretion.

Sub Step Not Performed:

W.R RICHARDS

NASA PH-H (1/2/-0)

USA ETM //- 2/-0/

Not Performed: NI A

*** End of Operation 15 ***



OPERATION 20 Ice Prediction Briefing

Shop: SE

Cntrl Rm Console: NA

OPR: ETM Zone: NA

Hazard (Y/N): N
Duration (Hrs): 0.5

NOTE

Ref: NSTS 16007 (LI) NSTS Program Launch Commit Criteria - Hazardous Gas Subsystem and Appendix F defines the ET No-Ice Zone.

20-1 CICE

Conduct L-1 day ice prediction briefing with launch director.

PH-H Signature

OMRSD S00FA0.900 SSS

20-2 Operation - Ice Prediction Briefing complete.

*** End of Operation 20 ***

OPERATION 30 Pre-launch Walkdown

Shop: SE

Cntrl Rm Console: NA

OPR: ETM
Zone: PAD
Hazard (Y/N): N
Duration (Hrs): 2.0

WARNING

Personnel working at heights greater than 4 feet and within 6 feet of an unguarded edge shall wear a safety harness with a lanyard secured to an approved tie off point, substantial structural member (no handrails) or a properly installed life line.

NOTE

This operation is performed at approximately L-20 hours. When this operation is performed in support of a 24 hour scrub turnaround, the preceding launch scrub post drain walkdown and this pre-launch walkdown may be performed concurrently.

Inspections may also be performed from the RSS, GO₂ Vent Arm (GVA), -Y OWP, or +Y OWP if still extended and accessible.

Ref: 80901019010 (LI) ET Post Build Acceptance and In-Process Rework Requirements Manual - Offsite

NASA ET Mechanical Engineer (PH-H) or designee shall function as team leader. Following personnel are optional walkdown participants.

NASA Engr (4)
SFOC Engr (2)
LMSSC - LSS (1)
Boeing - LSS (1)
SRB ELE (1)
Thiokol - LSS (1)



09-01-2001 APPROVED

OMI S6444 J02 APPROVED

- 30-1 Debris inspection team **perform** walkdown of SSV and MLP per following:
 - 1. Team leader **verify** S6444 pre-test briefing complete.
 - 2. Assemble following essential personnel

NASA PH-H Engineering - 1 SFOC ETM Engineering - 1

3. Inspect following areas (as a minimum) from the MLP, RSS and FSS to identify/ resolve potential debris sources.

Areas to be inspected

- A. Launch vehicle external surfaces
 - Orbiter
 - SRB's
 - External Tank
- B. MLP surfaces
 - LH and RH SRB holddown posts
 - Deck including deck bolts, fixtures, and edge gutters
 - SSME LH and RH SRB exhaust openings, and sound suppression (SS) troughs
 - TSM's and camera housings
- 4. Ref Table 30-1, **document** and SIM Photograph SSV and Launch PAD Configuration.

Description: Pre launch walkdown.

OMRSD S00U00.030-1 555

Record all facility discrepancies in S0007. Submit copy to PAD leader and notify TBC/CTC. Verify no constraints to continue.

PH-H Jer Thele Date "25 51

ETM 1/290 Date 11/290

30-3 Operation - Pre-launch Walkdown complete.

OMI S6444 J02 APPROVED

Photos from MLP				
<u>Photo</u>	Camera Orientation	Lens	Notes	
ET -Z	Vertical	28 mm		
Aft Dome	Horizontal	28 mm		
Aft Dome	Horizontal	35-70 mm		
LH SRB from North	Horizontal	35-70 mm	All water troughs in view	
LH SRB from North	Vertical	35-70 mm	3-4 water troughs in view	
LH SRB from East	Vertical	35-70 mm		
RH SRB from North	Horizontal	35-70 mm	All water troughs in view	
RH SRB from North	Vertical	35-70 mm	3-4 water troughs in view	
RH SRB from West	Vertical	35-70 mm		
SRB Heater Elec T-0	Horizontal	35-70 mm	Foam intrusion; May need flash	
North HDP	Vertical	35-70 mm	Representative view	
South HDP	Vertical	35-70 mm	Representative view	
TSM T-0 LH ₂	Vertical	35-70 mm	Flash needed	
TSM T-0 LO ₂	Vertical	35-70 mm	Flash needed	
Orbiter Left & Right Wing	Vertical	35-70 mm	From below ET (1 Photo each wing)	



135 Ft Level Photos

Photo	Camera Orientation	Lens	Notes
LO ₂ UMB	Vertical	35-70 mm	From OWP usually during T5401
LH ₂ UMB	Vertical	35-70 mm	From OWP usually during T5401

215 Ft Level Photos

<u>Photo</u>	Camera Orientation	Lens	Notes
ET surfaces from FSS	Vertical	35-70 mm	
LH SRB Frustrum and FWD skirt	Vertical	35-70 mm	
RH SRB Frustrum and FWD skirt	Vertical	35-70 mm	
Jack Pad C/O's	Horizontal	35-70 mm	Flash needed (1 each C/O)
LO ₂ Ogive Cable Tray	Vertical	35-70 mm	From RSS roof

255 Ft Level Photos

<u>Photo</u>	Camera Orientation	Lens	Notes
ET surfaces with GO ₂ vent ducts in view	Vertical	35-70 mm	
GO ₂ vent ducts	Horizontal	250 mm	

*** End of Table 30-2 Photo Requirements for SSV and Launch Pad Configuration

*** End of Operation 30 ***



OPERATION 40 Ice Frost Debris Console Initial Configuration Setup

Shop: SE

Cntrl Rm Console: FR2

OPR: ETM Zone: NA

Hazard (Y/N): N Duration (Hrs): 3.0

NOTE

The next step sets up the photo processing laptop for use in the Firing Room. This is not a constraint to set up of the console or to final inspection team operations. Network or equipment failures on the photo processing machine shall be annotated below.

- 40-1 Configure computer to perform image processing, analysis, and recording:
 - 1. Connect following equipment at Ice/Frost console:
 - power cable to computer
 - "Dazzle" capture card to laptop parallel port
 - "Y" adapter to laptop PS2 port
 - keyboard to keyboard port on "Y" adapter
 - mouse to mouse port on "Y" adapter
 - monitor to laptop
 - 2. Insert Xircon Network Card into Personal Computer PCMCIA port.
 - 3. Connect ethernet (gray) cord to Xircon Network Card.
 - 4. Remove terminator from video cable.
 - 5. Plug BNC-to-RCA adapter into end of video cable.
 - 6. Plug video cable into "Dazzle" DVC "video in".
 - 7. **Power-up** Trouble Console VCR.



OMI S6444 J02 APPROVED

8.	Log-on to KSC Ground Ops. Click-on Start/Programs/Dazzle.
	•
9.	Confirm above equipment as operational and record results.
	Results NOMINAL
	16 11 9
	ETM NA KAT H
	NOTE
	next step verifies the setup of the infrared scanners. This is not a constraint
to set	up of the ice console. IR scanner condition shall be annotated below.
Ve	rify IR scanner operation condition, annotate below.
Ve	rify IR scanner operation condition, annotate below. RSS:
Ve	
Ve	RSS:
	RSS: SV CS 2: OK NOTE
The r	RSS:
The r	RSS:
The r This opera	NOTE next step verifies the operation of console monitors in the Firing Room. is not a constraint to set up of the console or to final inspection team ations. Equipment condition shall be annotated below.
The r This opera	RSS:
The r This opera	NOTE next step verifies the operation of console monitors in the Firing Room. is not a constraint to set up of the console or to final inspection team ations. Equipment condition shall be annotated below. erify console condition by powering on monitors and tape recorders.
The r This opera	NOTE next step verifies the operation of console monitors in the Firing Room. is not a constraint to set up of the console or to final inspection team ations. Equipment condition shall be annotated below.

W/29/21

NOTE

ET OTV pre-mapping/initial position of cameras may be performed in random order.

Ref: 79K24576 (LI) OTV System Installation, LC 39, Pad A and

Ref: 79K24522 (LI) OTV System Installation, LC 39, Pad B define OTV camera locations.

FOV designates field-of view. RSS and -Y OWP must be retracted for completion of pre-mapping.

Pre-mapping steps/substeps in the remainder of this operation need not be performed if supporting a scrub turnaround and if performed during a previous run.

It is preferred to record all pre-mapping scanning on a single tape. However, multiple tapes may be used when lighting/launch countdown constraints necessitate such.

40-4 CVM1 ITV1 223

Perform OTV pre-mapping of External Tank exterior surfaces using OTV Cameras 004/104, 009/109, 013/113, 033/133, 042/142, 054/154, 055/155, 056/156, 060/160, 061/161, 062/162, 063/163, 064/164, 065/165, 066/166, and 067/167 as follows:

- Insert designated pre-map tape into trouble console VCR.
- Punch-up camera number on trouble monitor.
- Start recording on pre-map tape. Record start time (GMT).
- Scan from top-to-bottom, left-to-right and right-to-left at approximately full zoom-in.
- Stop recording on pre-map tape. Record stop time (GMT).
- Record data in Table 40-1.
- Repeat with each OTV camera listed until each has been used to scan the External Tank.
- Remove pre-map tape from trouble console VCR.

Brewer Date 11/29/01
FREWER

Not Performed: NA

40-5 CVM1 JTV1 223

> Position OTV Cameras 004/104, 009/109, 013/113, 033/133, 042/142, 054/154, 055/155, 056/156, 060/160, 061/161, 062/162, 063/163, 064/164, 065/165, 066/166, 067/167, 070/170, and 071/171 to initial positions as defined in Table 40-2.

> > ETM Date 11/29/01

Not Performed: NA

0 / Sac Elm

Table 40-1 ET	Pre-Mapping Data	169A Tape# 170A	
OTV	Start Time (GMT)	Stop Time (GMT)	
Camera		_	
004 / 104	12:50	12:59	
009 / 109	12:48	12:56	
013 / 113	12:29	12:36	
033 / 133	12:37	12:42	
042 / 142	12:56	D 13:04	
054 / 154	12:42	12:48	
055 / 155	12:12	12:18	
056 / 156	12:18	12:26	
060 / 160	11:50	12:01	
061 / 161	12:03	12:06	
062 / 162	12:07	12:22	
063 / 163	11:54	12:08	
064 / 164	12:26	12:26 12:40	
065 / 165	12:08	12:12	
066 / 166	12:23	12:29	
067 / 167	12:40	12:48	

Notes:		Du	Scans	canada	Nominal	
						
				-		

Table 40-2 (OTV Camera Initial Positions
OTV Camera	Initial Position
004 / 104	FOV centered on GUCP
009 / 109	FOV on LH ₂ Umbilical including ET/Orbiter interface. Vary close-up and wide angle views with 063/163 and 064/164.
013/113	Full zoom in. View SW GO ₂ Vent Louver area.
033 / 133	FOV perpendicular to ET and with LO ₂ -to-Intertank splice at frame top and LH ₂ -to-Intertank splice at frame bottom. Then tilt down until XT2058 is in frame center.
042 / 142	FOV centered on Orbiter Access Arm-to-Orbiter interface.
054 / 154	FOV to encompass approximately 3 feet forward of XT2058 to 2 feet aft of XT2058. Orbiter wing and SRB should be in view at frame left.
055 / 155	Set FOV on north bridge LH ₂ pipeline flange.
056 / 156	FOV with LH ₂ Aft Dome in frame bottom and XT2058 in view at frame top.
060 / 160	Full zoom in. View SW GO ₂ Vent Louver area.
061 / 161	Full zoom-in. Adjust FOV until ET LO ₂ -to-Intertank splice is centered vertically and view is perpendicular to ET. Pan right until edge of the ET comes into view. Note: LO ₂ Tank may pass out-of-view.
062 / 162	Full zoom in. View NW GO ₂ Vent Louver area.
063 / 163	FOV on LH ₂ Umbilical including ET/Orbiter interface. Vary close-up and wide angle views with 009/109 and 064/164.
064 / 164	FOV on LH ₂ Umbilical including ET/Orbiter interface. Vary close-up and wide angle views with 009/109 and 063/163.
065 / 165	Full zoom out. Set FOV on aft part of ET with frame bottom approximately 2 feet below LH ₂ Aft Dome.
066 / 166	FOV perpendicular to ET with LO ₂ -to-Intertank splice at frame top. Then tilt down until Orbiter RH Wing/SRB intersection is in frame lower right.
067 / 167	Set FOV with LH ₂ Aft Dome toward frame bottom and 2 nd black ring of SRB in view.
070 / 170 071 / 171	Select down wind camera of these two as wide angle view of the SSV. Set up wind camera for close-up view of SSME's.



09-01-2001 APPROVED OMI S6444 J02 APPROVED

40-6 Operation - Ice Frost Debris Console Initial Configuration Setup complete.

ETM OT Date 11/29 01

*** End of Operation 40 ***

09-01-2001 APPROVED OMI S6444 J02 APPROVED

OPERATION 50 SSV Debris Assessment

Shop: SE

Cntrl Rm Console: FR2

OPR: ETM
Zone: NA

Hazard (Y/N): N Duration (Hrs): 18.0

NOTE

1

Steps in this operation are contingent upon progression of launch countdown operations and may not be performed if countdown is terminated.

Entire Operation Not Performed: NA

NOTE

Until otherwise indicated, all times are referenced to S0007, S0014 or S0037 timelines.

No operations/steps within this subtask OMI may be performed as a stand-alone procedure. This OMI may only be performed as a subtask to \$0007/\$0014/\$0037.

NOTE

Ref: SPI SP-519 (LI) OMI and OM Implementation and Ref: SFOC GO0007 (LI) Quality Planning Requirements Document (QPRD), following step complies with requirements for ROR-as-CMQC function.

50-1

CTIF TBC TBC CMQC 136



CTC TBC 232 TBC CTIF 136

Perform OTV and ice/frost monitoring area setups.

ETM Date 1)

50-3

 CTIF
 TBC
 136

 TBC
 CTC
 CTC

 CTC
 STM
 232

Verify Operation 10- Support Preparations complete.

ETM L. Date 11/29

50-4

CTIF

Verify Operation 20 - Ice Prediction Briefing and Operation 30- Prelaunch Walkdown complete.

ETM + Pale Date

Date 1 29 01

CTIF CVM1 222 CVM1 222

Verify:

- All OTV cameras are on, tapes in recorder, and ready to commence OTV scanning, monitoring, and recording.
- Trouble tape recorder is ready.

• Ice Frost Debris Console Initial Configuration Setup complete.

ETMK. Scale Date 11/20

50-6

All personnel participating in OTV operations **report** test ready

status.

Support: COMM

09-01-2001 APPROVED

OMI S6444 J02 APPROVED

50-7

CTIF TBC 136 TBC CTC 232

Ice Frost Console Area Setups for OTV scanning complete.

Report readiness.

ETM Pro Secret Date " /29

Not Performed: NI A

50-8

CTIF CVM1 222

From start of LO_2 chilldown until seal deflation/ GO_2 vent hood retraction, **monitor** the +Y/-Y GO_2 vent seal-to-ET interface for seal fretting and continuous GO_2 escape.

OMRS S00FB0.350-1

ETM NA Date NA

Not Performed: [E]

11/29/01

NOTE

GO₂ vent seal fretting could induce damage to ET SOFI. Continuous GO₂ venting could result in formation of ice in the no ice zone (ref NSTS 16007). Ultimate decision to lift the vent hood rests with CMEC.

50-9

CTIF TBC 136 CMEC

If +Y/-Y GO₂ vent seal fretting or continuous GO₂ escape detected from start of LO₂ chilldown until seal deflation, **notify** CMEC for GO₂ vent hood removal.

ETM L. Date 11/2

Not Performed: $\boxed{01}$

50-10

CTIF CIPC 222

Monitor wind speed and direction from start of LO₂/LH₂ chill down through launch/scrub. CIPC **notify** CTIF if winds measured at 38 knots or greater from North, +/-30 degrees as measured at 60 feet.

ETM Second

Date 11/29/51

Not Performed: [5]

11/29/31

© Zpi ETE

NOTE

Excessive vapors are defined as being more severe than those described in NSTS 08303 (LI) NSTS Program Ice/Debris Inspection Citeria or NSTS 16007 (LI) NSTS Program Launch Commit Criteria - Hazardous Gas Subsystem.

50-11

CTIF CVM1 222 CVM2

From start of LO_2/LH_2 loading until Prepressurization (LO_2 at T-2M55s and LH_2 at T-1M57s):

- 1. Monitor following ET-Orbiter MPS areas for leakage:
 - LO₂ Feedline (portion external to the Intertank)
 - LH₂ Feedline
 - LH₂ Recirculation Line
 - LH₂ Aft Dome Manhole Cover(s)
 - ET-Orbiter LO₂/LH₂ Umbilical Disconnects
 - LH₂ T-0 Umbilical
 - LO₂ T-0 Umbilical
- 2. Verify no visible cryogenic liquid of excessive vapors.

OMRS S00FB0.360-1

ETM	NIN	Date NA
		Not Performed:

CTIF CVM1 222 CVM2

Monitor and **videotape** following ET TPS surface areas and GO_2 Vent Area during LO_2/LH_2 loading through Prepressurization (LO_2 at T-2M55s and LH_2 at T-1M57s):

- LH₂ Aft Dome
- LH₂ Barrel
- Intertank (external)
- LO₂ Tank
- GO₂ Vent Area
- Protuberances

OMRS S00FB0.005-1

ETM	AIK	Date NA
		Not Performed:
		11/29/01

50-13

CTIF CVM1 222

Perform Operation 60 - Group 1 Monitoring.

ETM	NIN	Date_ N A
		Not Performed: V29/01

CTIF CVM2 222

Perform Operation 70 - Group 2 Monitoring.

50-15

CTIF CVM2 222

Once per hour minimum, after start of LO₂/LH₂ (until LO₂/LH₂ low level sensors read dry), scan LO₂ feed line brackets and flange closeouts per Table 50-1.

ETM Not Performed: $\begin{bmatrix} ET \\ OI \end{bmatrix}$

ET 01 4

CTIF CICE 222

As count proceeds, for concerns/ observations identified:

- 1. **Record** observation/concern on trouble tape per Table 50-1.
- 2. **Document** observed condition on Table 50-2, Observation Worksheet.

Not Performed: 179/01

50-17

TBC CTIF 136 **CTIF** CICE 222

Perform Operation 80 - Final Inspection when called by S0007/S0014/S0037.



	Final SSV	scan typic	cally comm		OTE t L-2 hours.		
50-18		CTIF	CVM1 CVM2	222			
		Perform	ı final SSV	scan.			
				ETM_	NIM	Date_	NIA
						Not Perform	ned:
							11/29/01
50-19		CTIF	CVM1 CVM2	222	-		19 101
		At start count.	of T-9 min	ute hold	, configure O'I	ΓV cameras for	terminal
				ETM_	NIA	Date	AIM
13 Dreu 50 P TXV	1 29/01					Not Perforr	med: \\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\

If winds are from the north (+/-30 degrees) and are 38 knots (peak as measured at 60 feet above ground) or greater:

- 1. Monitor/videotape nose cone area during high winds.
- 2. Verify:
 - A. No ice formation on the +Y and -Y GO₂ vent seal footprint areas.
 - B. No damage to the ET TPS at the +Y and -Y GO₂ vent seal footprint areas.
 - C. No damage to the +Y and -Y GO₂ vent seals themselves.
 - D. No evidence of GO_2 leakage from +Y/-Y GO_2 vent seals to ET interface.

USA VM 075 OMRSD S00L00.150

ETM NA Date NA

Not Performed: 01

50-21

CTIF

Verify launch or launch scrub (drain back). Record data.

Launch NIA Scrub NIA

LAUNCH DELMED DUE TO ISS

HATCH PROBLEMS.

CRYO LOAD NEVER

INITIATED. D. Sale

ETA 11/29/01

Date NA Time NA GMT

Scrub at T- 6H

_ Date11/29/01

CTIF

ET-Orbiter MPS monitoring for leakage and ET TPS Surface Areas and GO₂ Vent Area monitoring/recording for launch complete.

3.5

OMRSD S00FB0.005-1 OMRSD S00FB0.360-1

Not Performed: [5]

11/29/0

NOTE

When completely filled and drain is initiated, it takes approximately 1 hour until the LH_2 tank low level sensors read dry, and approximately 1.5 hours until the LO_2 tank low level sensors read dry.

50-23

CTIF CVM1 222 CVM2

If launch scrubbed (or drain back declared) after start of LO_2/LH_2 slow fill mode:

- **Perform** Operation 90 LO₂/LH₂ Drain Monitoring.
- **Record** observations/concerns on trouble tape per Table 50-1.
- Document all observations/concerns on Table 50-2
 Observation Worksheet.

ETM	NIM	Date NA
		Not Performed: ET
		11/29/

(01 11/29/01

50-24	CTIF		
	GO ₂ Vent seal to ET interfa GO ₂ escape complete.	ce monitoring for seal fretting a	nd continuous
USA VM 075	OMRSD S00FB0.350-1		
0.12		ETM NA	Date_N A
		Not I	Performed: 101
50-25			1-
	CTIF CVM1 CVM2	222	
	Terminate scanni	ng operations.	
		ETM Souce	Date 11 Zala
50-26	CTIF CVM1 CVM2	222	
	Perform Operatio	n 100 - Console Securing.	
		ETM P. Sana	Date 11 29 3
50-27	CTIF		
,		g started, perform Operation 11	0 - Summary

Not Performed: 1/29/01

NA Date NA

			NOTE				
Following	step may be	not perf	formed at CTI	F discretion	on.		
CTIF TBC	TBC STM	136					
			occur at night, ration of walke	-	PAD xer	non light	ting be
					Not I	Perform	
	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,					,	11/29
,			NOTE				
	walkdown to walkdo		commences a	pproxima	tely 1.5	hours af	ter
	OW ICACI SCI	isors read	u ui y.			·	
	CTIF						
			after start of I ost-Drain Walk		anking,	perforn	1
			ETM NI	A		Date_	AlM
			ETM_NI				
			EIM W		Not 1	Perform	
			EIM W		Not 1		-
	CTIF		EIM W		Not 1		ed:
		occurred,	, perform Ope			Perform	
	If launch o	occurred,	, perform Ope			Perform launch	
	If launch o	occurred,	, perform Ope	eration 13		Perform launch	11/29
	If launch o	occurred,	, perform Ope	eration 13	0 - Post	Perform launch	11/29

09-01-2001

OMI S6444 J02 **APPROVED**

50-31

CTIF

If launch occurred, perform Operation 140 - Film Review.

ETM N/A Date N/A

Not Performed: 101

11 | 29 | 91

50-32

SSV Debris Assessment complete.

Table 50-1 Observation Documentation Procedure

1.	CTIF	CVM1 CVM2	222	Locate anomaly/concern on pertinent OTV(s)
2.	CTIF			Punch-up pertinent OTV on trouble monitor. Update trouble tape log in table below.
3.\	CTIF			Start the trouble tape.

NOTE

Trouble tape shall be allowed to run until sufficient OTV documentation of observation/concern has been made. OK to change OTV's while trouble tape is running.

4 CTIF

After observation/concern has been documented on the trouble tape, stop the trouble tape. Update trouble tape log below.

TROUBLE TAPE LOG

Trouble Tape No.	Start Time (GMT)	Stop Time (GMT)	OTV	Description
	(4)	(1000)		
****			W-004-00-00-00-00-00-00-00-00-00-00-00-00	
			<u> </u>	
				`
		TROUE	BLE TAPE LOC	3



Table 50-1 Observation Documentation Procedure

Trouble Tape No.	Start Time (GMT)	Stop Time (GMT)	OTV	Description
··················			 	
	\		 	

		<u> </u>		
······			~	
			**** *********************************	
	^			
······································				
	-			

*** End of Table 50-1 Observation Documentation Procedure ***

Observation No		
Observed By:		
Date	Time	GMT
\	down)	
Description:		
	\	
	\	
Acceptance Rationale	e (or IPR/PR No.);	
Acceptance Rationale		
-		
CICE		

Record following inf	ormation for cond	lition observe	d:	
Observation No.				
Observed By:				
Date	Time		GMT	
Camera No. (or Walke				
Description:				
Acceptance Rationale	(or IPR/PR No.):			
CICE		Date		
CTIF		Date		

Record following in	formation for cond	ition observed:		
Observation No.				
Observed By:				
Date			GMT	and the second s
Camera No. (or Walk				
Description:				
		Market		
Acceptance Rational				
			\	
· · · · · · · · · · · · · · · · · · ·			$\overline{}$	
			$\overline{}$	
CICE		Date		
CTIF		Date		

Record following information to	for condition observed:
Observation No.	
Observed By:	
Date Ti	
Camera No. (or Walkdown)	
Description:	
	,
Acceptance Rationale (or IPR/PF	
CICE	Date
CTIF	Date

Observation No	·		
Observed By:			
Date			
\	own)		
Description:			
Acceptance Rationale	(or IPR/PR No.):	A 1 - 144 -	
Acceptance Rationale	(or IPR/PR No.):		
Acceptance Rationale	(or IPR/PR No.):		
Acceptance Rationale	(or IPR/PR No.):		
Acceptance Rationale	(or IPR/PR No.):		
Acceptance Rationale	(or IPR/PR No.):		
Acceptance Rationale	(or IPR/PR No.):		
Acceptance Rationale	(or IPR/PR No.):		
Acceptance Rationale	(or IPR/PR No.):		

Record following infor	mation for cond	ition observed	:	
Observation No				
Observed By:				
Date	Time		GMT	
Camera No. (or Walkdo				
Description:				
Acceptance Rationale (o	r IPR/PR No.):			
A4-444				
CICE		Date		
CTIF		Date		

Observation No			
Observed By:			
Date	Time	GMT	
Camera No. (or Wa	alkdown)		
Description:			
Acceptance Ration	ale (or IPR/PR No.):		
CICE		_ Date	
CICE			
CICE		_ Date	
CICE		_ Date	

Record following informs	ation for condi	tion observed	i:	
Observation No				
Observed By:				
Date	Time		GMT	
Camera No. for Walkdown				
Description:				
			W-Marco Lit.	
Acceptance Rationale (or I				
CICE		Date		
CTIF		Date		
*** End	of Table 50-2	Observation	Worksheet ***	\
	*** End of	Operation 50	***	

OPERATION 60 Group 1 Monitoring LO2 Chill Down Thru T-0

Shop: SE

Cntrl Rm Console: FR2

OPR: ETM Zone: NA

Hazard (Y/N): N Duration (Hrs): 15.0

NOTE

Do not perform this operation if launch scrub declared before LO₂ Chill Down commences.

Operation Not Performed: $|\nabla z|$

NOTE

This operation monitors LO₂ Ogive and Barrel and associated components/ areas from start of Chill Down through T-0 via OTV cameras 013/113, 060/160, 061/161, 062/162, 063/163 and 064/164.

OTV cameras 013/113 and/or 062/162 will view -Y GO₂ Vent Hood Seal at all times. At no time will both cameras be positioned away from the -Y GO₂ Vent Hood Seal.

OTV cameras 068/168 and 069/169 view SW and NE GO_2 Vent Areas respectively. These are fixed FOV cameras and do not have pan, tilt, etc. capability.

Steps in this operation are contingent upon progression of launch countdown operations and may be not performed if countdown is terminated.

LO₂ Chill Down To L-2 Hour Mark

		LO ₂ Cn	mi Down 10 L-2	nour mai	K	
60-1	CVM1	JYVR	138			
			O ₂ Chill Down, star 51/161, 062/162, 063			
			ETM		Date	
	Support:	COMM				
60-2	Record L	.Ò _₹ MPS C	hill Down start date	and time (GN	MT).	
	LO	2 MPS Chil	ll Down Date	GMT	Time	GMT
		`	ETM	7	Date	
60-3	CVM1	JTV1	223			
	004/104, and 069/1	013/113, 0	hill Down until start 60/160, 061/161, 06 or/videotape EV-TP: owed.	2/162, 063/16	63, 064/164, 068	3/168,
	Support:	COMM	ETM	\	Date	
					Not Performed	i :
					\	

60-4	Record LO	Slow Fill	start date	and time (C	GMT),		
		LO ₂ Slo	w Fill Dat	e	GMT	Time	GMT
			ETN	М		Dat	re
						Not Perfo	rmed:
60-5	Record LO	Fast Fill s	tart date a	nd time (G	MT).		
		LO ₂ Fas	st Fill Date		GMT	Time	GMT
			ET	M		Dat	e
						Not Perfo	rmed:
60-6	CVM1	JTV1	223				
	From start of monitor/vio 060/160, 06 LO ₂ Tank. A GO ₂ Vent H	leotape ET 1/161, 062/ Alternate ca	`-TPS surfa /162, 063/ ameras an	aces on OT 163, 064/16 d scan fror	TV camera 64, 068/10 n Intertan	as 004/104, 68, and 069 k to LO ₂ Ba	013/113, /169. Scan arrel Splice to
			ETN	М		Dat	e
	Support: Co	MMC		,			\
						Not Perfo	rmed:

	60-7	Record LO ₂ Topping of	late and time (GM	T).		
`		LO ₂ To ₁	pping Date	GMT T	ime	GMT
			ETM		Date	
				N	ot Performed	:
	60-8	Record LO ₂ Stable Re	plenish mode star	t date and time	(GMT).	
		LO ₂ Stable Repl	enish Date	GMT T	ime	GMT
			ETM	· · · · · · · · · · · · · · · · · · ·	Date	
				N	ot Performed	<u>:</u>
	60-9	CVM1 JTV1	223			
		From time LO ₂ Stable scan (approximately L-surfaces on OTV came 063/163, 064/164, 068 vapors allowed.	-2 hours), monitu ras 004/104, 013/	r, scan and vid N3, 060/160, 0	eotape ET-TP 061/161, 062/1	S 62,
		Support: COMM	ETM		Date	
		Support: COMM				
				N	lot Performed	:

Final SSV Inspection Scan

NOTE

Final SSV Inspection Scan should begin not later than 1.5 hours prior to start of T-9 minute hold (approximately L-2 hours) to allow ample time to finish. Final SSV Inspection Scan shall include the ET, SRB's and the Orbiter.

Final scan may be altered or partially performed in the event that time constraints will not permit a complete SSV scan prior to start of T-9 minute hold.

During Final SSV Inspection Scan the camera lights on OTV cameras 061/161 and 062/162 shall be turned "Off" when view passes over the Orbiter cockpit to preclude "distracting" the Flight Crew.

60-10 CVM1 JTV1 223

Perform Final SSV Inspection Scan with OTV cameras 004/104, 013/113, 060/160, 061/161, 062/162, 063/163 and 064/164. Scan passes shall view entire SSV with cameras at approximate full zoom in during final scan.

ETM	Date
	Not Performed:

Not Performed:

Terminal Count Camera Positions

NOTE

This step performed for SSME ignition only and may be not performed if launch is scrubbed prior to pick-up of T-9 minute count. Cameras must be positioned for ignition no later than T-9 minutes. "Spot" scanning after pick-up of the T-9 minute count is acceptable with CICE concurrence.

Cameras may be positioned for SSME ignition in an arbitrary order.

Camera positions may be altered real-time with CICE concurrence. Alterations should be determined prior to pick-up of T-9 minute count to allow sufficient time for OTV operators to rehearse camera movements.

CVM1 camera positions for SSME ignition are defined in Table 60-1.

60-11	CVM1	JTV1	223
00-11	C A TATE	JIVI	

Ref Table 60-1, **position** cameras 004/104, 013/113, 042/142, 054/154, 060/160, 062/162 for terminal count.

Support: COMM Date______

60-12 Operation - Group 1 Monitoring - LO₂ Chill Down Thru T-0 complete.



Table 60-1 CVM1 Camera Positions for Terminal Count

NOTE

This Table defines CVM1 camera positions for terminal countdown. Cameras should be positioned for ignition no later than pick-up of T-9 minutes count. "Spot" scanning after pick-up of the T-9 minute count is acceptable with CICE concurrence.

Cameras may be positioned for SSME ignition non-sequentially.

Camera positions may be altered real-time with CICE concurrence. Alterations should be determined prior to pick-up of T-9 minute count to allow sufficient time for operators to rehearse camera movements with ice console.

The GO_2 Vent Arm (GVA) retracts at T-2m30s.

CVM1 Camera Positions Are Defined As Follows:

004/104

GUCP centered in frame so that GUCP will stay in view throughout SRB "twang".

042/142

At approximately T-1 hour, view and monitor Orbiter access arm while Orbiter hatch is being closed.

At T-7m30s, watch Orbiter access arm retract, then view bipod strut in center of frame, LO₂ feedline fairing in top of frame, and Orbiter hatch in right of frame.

054/154

At T-3m50s, view Orbiter right hand body flap movement, then zoom out with Orbiter/ET umbilicals at approximate frame center, Orbiter trailing edge at frame bottom, and edge of +Y (RH) SRB just in view at frame right.



Table 60-1 CVM1 Camera Positions for Terminal Count

013/113

At T-2m30s, watch lift of GO₂ vent arm for debris and nose cone/vent louvers for ice damage. Immediately following lift of GO₂ vent arm, center frame on GO₂ vent louver and then zoom-out so that entire ET movement is seen during SRB 'twang' at SSME ignition.

060/160

At approximately T-2m30s, after GO₂ vent arm retracts, go full zoom in for a close-up inspection of the GO₂ vent louver. After CICE concurrence, go full zoom out and position camera with SSV centered and ET nose cone at frame top.

062/162

At approximately T-2m30s, after GO₂ vent arm retracts, go full zoom in for a close-up inspection of the -Y GO₂ vent louver. After CICE concurrence, zoom out until ET nose spike is at top of frame with ET centered.

061/161

At approximately **T-4m00s**, verify camera lights are off. Then position camera to view astronaut closing visor at T-2 minutes 00 seconds.

068/168 and 069/169

Immediately after GO2 vent hood lift, turn lights off to preclude distracting orbiter crew when the GVA rotates to its latchback position.

*** End of Table 60-1 Camera Positions for Terminal Count ***

*** End of Operation 60 ***



OPERATION 70 Group 2 Monitoring - LH₂ Chill Down Thru T-0

Shop: SE

Cntrl Rm Console: FR2

OPR: ETM Zone: NA

Hazard (Y/N): N Duration (Hrs): 15.0

NOTE

Do not perform this operation if launch scrub declared before start of LH₂ Chill Down.

Operation Not Performed

11/29/01

NOTE

This operation monitors LH_2 Barrel and associated components/areas start of LH_2 Chill Down to pre-pressurization via OTV cameras 009/109, 033/133, 054/154, 055/155, 056/156, 065/165, 066/166 and 067/167.

Steps in this operation are contingent upon progression of launch countdown operations and may be not performed if countdown is terminated.



LH₂ Chill Down To L-2 Hour Mark

X 0-1	CVM2	JYVR	138					
	At start o	f LH ₂ Chill 055/155, 0	Down,					133,
	Support:	СОММ		ETM			Date	
70-2	Record 1	H ₂ Chill D	own sta	rt date and	time (GM	Т).		
		LH	I ₂ Chill		e			
70-3	CVM2	JTV2	225					
	033/133,	rt of propel! 054/154, 0 (videotape lowed.	55/155,	056 X 56, 0	065/165, 06	6/166 and	067/167,	
	Support:	COMM		ETM			Date	
						Not 1	Performed	:
							\	



₹0-4	Record LH ₂ Slow Fill start date and time (GMT).							
		LH ₂ Slow Fill Date	Time(ЗМТ				
		ETM	Date					
			Not Performed:					
70-5	Record LH ₂ Fas	t Fill start date and time (GMT	`).					
	``	LH ₂ Fast Fill Date	Time(ЭМТ				
		ETM	Date					
			Not Performed:					
70-6	CVM2 JTV	2 225						
	From start of LH ₂ Fast Fill until stable replenish mode is established, scan LH ₂ Tank. Alternate OTV cameras 033/133, 054/154, 055/155, 056/156, 065/165, 066/166 and 067/167 and scan/videotape from LH ₂ Aft Dome to Intertank.							
		ETM	Date					
	Support: COMM	И						
			Not Performed:					

70-7							
	Record start date and time (GMT) for LH ₂ Topping.						
		LH ₂	Topping Date	Time	GMT		
			ETM	Date			
				Not Performed:_			
70-8	Record LH ₂ S	table Reple	nish mode start date	and time (GMT).			
	LH	I ₂ Stable R	eplenish Date	Time	GMT		
			ETM	Date			
		`		Not Performed:_			
70-9	CVM2 JT	V2 22	5				
	During LH ₂ Stable Replenish mode and until time for final scan (approximately L-1.5 hours), on OTV carneras 033/133, 054/154, 055/155, 056/156, 065/165, 066/166 and 067/167, monitor/videotape ET TPS surfaces including LO ₂ Feed Line, LH ₂ Feed Line, LH ₂ Recirculation Line, LH ₂ Aft Dome and manhole covers, LH ₂ /LO ₂ Umbilicals, and TSM LH ₂ /LO ₂ Umbilicals. No cryogenic liquid or excessive vapors allowed.						
	Support: COM	им	ETM	Date			
				Not Performed:			



Final SSV Inspection Scan

NOTE

Final SSV Inspection Scan should begin not later than 1.5 hours prior to start of T-9 minute hold (approximately L-2 hours) to allow ample time to finish. Final SSV Inspection Scan shall include the ET, SRB's and the Orbiter.

Final SSV haspection Scan may be altered or partially performed in the event that time constraints will not permit a complete SSV scan prior to start of T-9 minute hold.

70-10 CVM2 JTV2 \ 225

Perform Final SSV Inspection Scan with OTV cameras 009/109, 033/133. 054/154, 055/155, 056/156, 065/165, 066/166 and 064/164. Scan passes shall view entire SSV with cameras at full zoom in during final scan.

	ЕТМ	Date
Support: COMM		
		Not Performed:

T-9 Minute Terminal Count

NOTE

Next step performed for terminal count only and may be not performed if launch is scrubbed prior to pick-up of T-9 minute terminal count. Cameras must be positioned for SSME ignition no later than T-9 minutes. 'Spot' scanning after pick-up of the T-9 minute terminal count is acceptable with CICE concurrence.

Cameras may be positioned for SSME ignition in an arbitrary order.

Camera positions may be altered real-time with CICE concurrence. Alterations should be determined prior to pick-up of T-9 minute count to allow sufficient time for OTV operators to rehearse camera movements.

CVM2 camera positions for terminal count are defined in Table 70-1.

70-11 CVM2 JTV2 225

Ref Table 70-1, **position** cameras 009/109, 033/133, 056/156, 065/165, 066/166 061/161, 070/170, 071/17\, and 067/167 for terminal count.

ETM______Date_____

Support: COMM

Not Performed:

70-12 Operation - Group 2 Monitoring - LH₂ Chill Down Thru \(\cup_{\cup}\) 0 complete.

Table 70-1 - CVM2 Camera Positions for Terminal Count

NOTE

This Table defines CVM2 camera positions for terminal countdown. Cameras should be positioned for ignition no later than pick-up of T-9 minutes count. "Spot" scanning after pick-up of the T-9 minute count is acceptable with CICE concurrence.

The Orbiter access arm (OAA) retracts at T-7M30S. Orbiter body flap movement occurs at T-3m50s.

Cameras may be positioned for SSME ignition non-sequentially

Camera positions may be altered real-time with CICE concurrence. Alterations should be determined prior to pick-up of T-9 minute count to allow sufficient time for operators to rehears camera movements with ice console.

ETO

Group 2 Camera Positions Are Defined As Follows:

033/133

Full zoom out. LO₂ feed line in frame center and MLP deck at bottom.

053/155

View ET aft dome with MLP deck just out of view at bottom, ET XT-2058 ring frame at frame top and both SRB's just in view at sides.

056/156

View ET aft dome with MLP deck just out of view at bottom. ET XT-2058 ring frame at frame top and both SRB's just in view at sides.

065/165

Full zoom out. SSV centered. MLP deck edge just in view at bottom.

066/166

ET centered. Intertank to LO₂ Barrel splice at frame top with the majority of Orbiter wing in view.

067/167

Center on GUCP for optimum view.

070/170 and 071/171

At T-9m00s, zoom in on space shuttle main engine with camera providing best view. Zoom out on SSME for wide angle view with other camera.

009/109

At approximately **T-3m50s**, position to view Orbiter body flap and elevons movement. Afterwards, center on LH₂ umbilical with -Y vertical strut at frame top.

061/161

At approximately T-1m30s, tilt-up to GO₂ Vent Footprint. Zoom in. Pause. If footprint is acceptable, zoom out and tilt down to view Orbiter nose/cockpit through lifton.

*** End of Table 70-1 - CVM2 Camera Positions for Terminal Count ***

*** End of Operation 70 ***

II Da d

OPERATION 80 Final Inspection

Shop: SE

Cntrl Rm Console: FR2

OPR: ETM
Zone: PAD A/B
Hazard (Y/N): Y
Duration (Hrs): 3.0


NOTE

Final Inspection may not need to be performed depending on LO₂/LH₂ tanking and launch countdown, as determined by CTC/FTL.


Final Inspection Team stay time guidelines for each level are given in Table 80-1. These guidelines are for reference only and may be deviated from at PICE discretion.

Operation Not Performed:

11/29/21

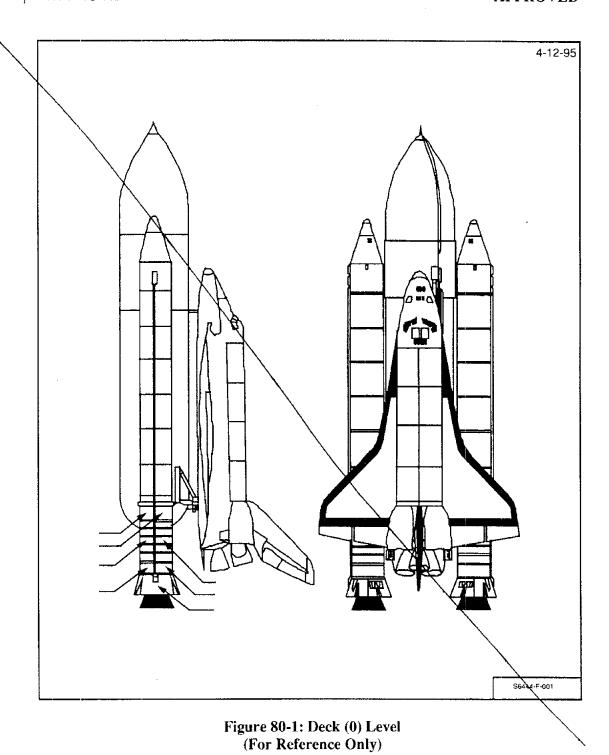



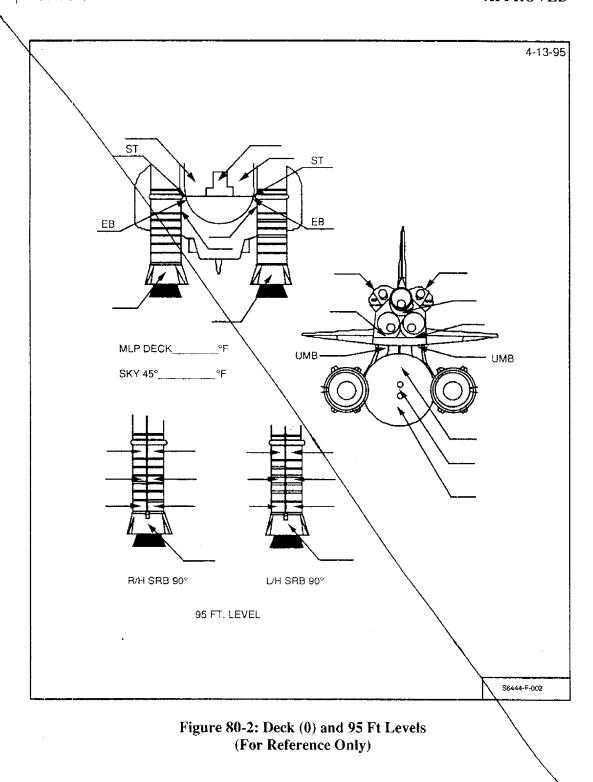

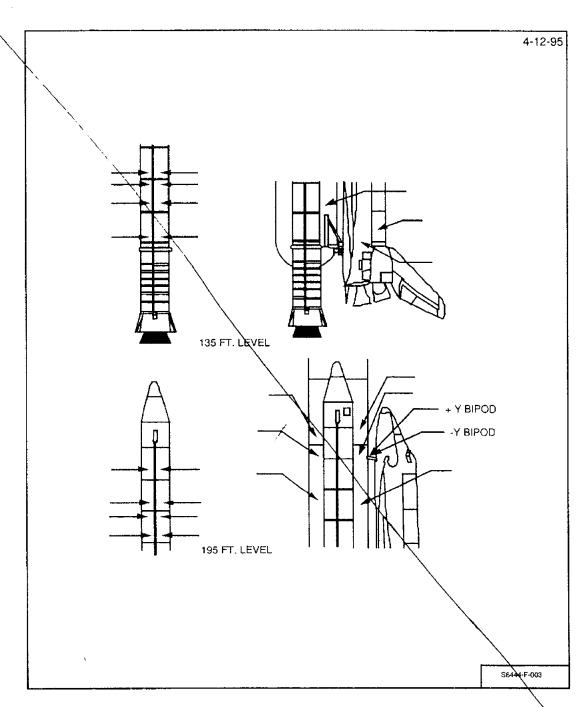


Figure 80-3: 135 and 195 Ft Levels (For Reference Only)



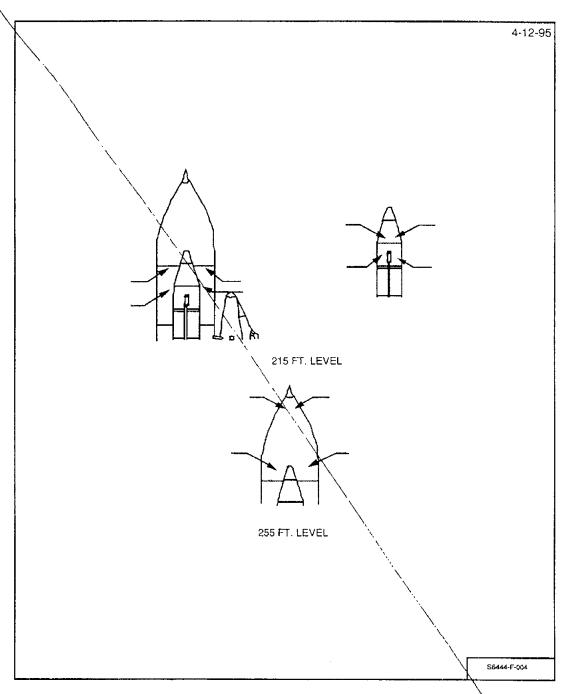


Figure 80-4: 215 and 255 Ft Levels (For Reference Only)

WARNING

Personnel working at heights greater than 4 feet and within 6 feet of an unguarded edge shall wear a safety harness with a lanyard secured to an approved tie off point, substantial structural member (no handrails) or a properly installed life line.

WARNING

Personnel performing final inspection shall be attired in Nomex coveralls with gloves and hoods. Personnel shall have available gloves, hoods, and ELSA at all times during walkdown.

Personnel using Sony DKC-ID1 camera shall verify lithium ion battery is securely locked in bayonet connector and the lithium button battery door is locked and taped in place. Personnel shall ensure the flash is not activated on the camera.

Personnel using Kodak DC-50/120 shall verify alkaline batteries are properly installed and the flash is not active on the camera.

Personnel using digital cameras (Sony DKC ID1, Kodak DC-50/120 shall not use these cameras in the presence of a hydrogen leak or an oxygen enriched atmosphere (readings greater than 23 percent O₂).

NOTE

Task Team Leader (TTL) for final inspection is PH-H. Additional personnel (listed below) may be added to the final inspection team with CTC, Launch Director, and Safety concurrence.

JSC Level II (1) PH-H (2) SFOC ETM (1)



80-1 Assemble following final inspection team mer
--

TTL - PH-H	(1)
PH-H	(1)
SFOC ETM	(2)
ŁMSSC LSS	(1)
SFOC Safety	(1)


80-2 Final inspection team **perform** walkdown of SSV and associated facilities as follows:

NOTE

Following substep may be not performed with TTL concurrence.

Tables 80-2 and 80-3 are reference only items. Images are to be taken of targets of opportunity. Images must be taken with 35 mm and digital cameras. Digital images shall be inputted into SIMS.

1. Ref Tables 80-2 and 80-3, photograph SSV points of opportunity during final inspection using 35 mm. **Record** data.

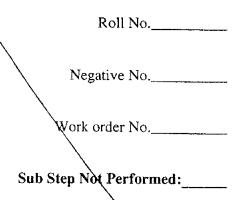

2. Reference Tables 80-2 and 80-3, take digital image of SSV points of opportunity using digital camera.

Description: Final Inspection Team

3. See Figures 80-1 through 80-4, measure and record (deg F) SS external surface temperatures using IR gun(s)/scanners.

NOTE

The following substep references inspection areas. However, inspection shall not be limited to these areas. Inspection shall be of entire SSV and specific areas of concern as defined by the TTL, CTC, or Launch Director.

4. Visually inspect:

- Orbiter aft engine compartment external surfaces for condensation and ice formations.
- ET TPS surfaces which cannot be observed by the OTV system.
- Specific areas of concern as determined by the TTL, CTC, or Launch Director.



80-4

OMRSD S00U00:Q20-A-1

OMRSD S00U00.020-C-1

OMRSD S00U00.020-D-1

80-3 Final Inspection complete. Verify no constraints to continue.

TTL (PH-H)

	SFOC-ETM	Date
Operation - Final Inspe	ection complete.	
	ETM	Date

Date



Table 80-1 Final Inspection Team Walkdown Stay Times

255 Ft Level - 5 Minutes

- LÔ₃ Ogive and Barrel acreage
- GO₂ Rressurization Line
- LO₂ Tank Cable Tray
- Visible LN SRB surfaces
- GO₂ Vent Ducts

215 Ft Level - 20 Minutes

- ET GH₂ 7 inch Vent Assembly
- ET acreage (between -Zand -Y axis)
- GO₂ vent area
- Orbiter tiles
- Visible SRB surfaces
- Inter tank-to-LO₂ Barrel splice

195 Ft Level - 10 Minutes

- LO₂ Feed Line
- ET/Orbiter Bipods (side and bottom view)
- -Y ET/SRB forward attachment (bottom view)
- -Y ET/SRB aft attachments (top view)
- Inter tank splice areas (LO₂ and LH₂)
- ET acreage (between -Y and +Z axis)
- Orbiter tiles
- Visible LH SRB surfaces

135 Ft Level - 10 Minutes

- LH₂ ET/Orbiter Umbilical
- -Y ET/SRB C/T
- -Y Vertical Strut
- LO₂ Feed Line
- ET acreage between -Y axis and +Z axis
- ET/Orbiter attachments (top view)
- Visible LH SRB surfaces
- Orbiter aft fuselage



Table 80-1 Final Inspection Team Walkdown Stay Times <u>Q Level - 30 Minutes</u>

- LH₂ Aft Dome
- Exacreage around +Z axis
- ET acreage around -Z axis
- LO₂ Feed Line
- LH₂ Feed Line
- ET/Orbitar attachments Bottom view
- ET/Orbiter LH₂ and LO₂ Umbilicals
- T-0 LH₂ and LO₂ Umbilicals
- Space Shuttle Main Engines (SSME)
- Orbiter tiles
- ET/SRB aft attachments
- Visible SRB surfaces
- SRB ignition overpressure sound suppression water troughs

*** End of Table 80-1- Final Aspection Team Walkdown Stay Times ***



Notes

Table 80-2 Final Inspection Team - Telephotos

TELEPHOTOS - 255 FT LVL

Photo Camera Orientation

GO₂ Vent Ducts Horizontal LO₂ Acreage Vertical

TELEPHOTOS - 215 FT LVL

<u>Photo</u> <u>Camera Orientation</u> <u>Notes</u>

-Y Bipod Ramp Horizontal From RSS

LO₂ P/L Ice Frost Ramps Vertical From RSS; Requires 3-4 shots

GO₂ Seal/Hood Horizontal From haunch & RSS

GUCP Vertical

TELEPHOTOS\195 FT LVL

<u>Photo</u> <u>Camera Orientation</u> <u>Notes</u>

-Y Bipod Ramp & Jack PAD Horizontal

C/O

LH₂ Acreage

TELEPHOTOS - 135 FT LVL

<u>Photo</u> <u>Camera Orientation</u> <u>Notes</u>

LH₂ UMB Horizontal

-Y Longeron Vertical If needed

Vertical

Jack Pad Closeouts Horizontal

09-01-2001 APPROVED

OMI S6444 J02 APPROVED

Table 80-2 Final Inspection Team - Telephotos

TELEPHOTOS - MLP

<u>Photo</u>	Camera Orientation	<u>Notes</u>
LH ₂ DMB	Horizontal	From West
LH ₂ UMB	Horizontal	From NW
EB-7	Horizontal	
EB-8	Horizontal	
LH ₂ Aft Dome	Horizontal	
Third Hard Point C/Q	Vertical	
LH ₂ Barrel	Horizontal	From North
SSV Overall	Horizontal	From North
SSV Overall	Horizontal	From East
LO ₂ F/L Bracket & Bellows	Vertical	XT-1973
LO ₂ F/L Bracket	Vertical	XT-1871
LO ₂ F/L Bracket	Vertical	XT-1623
LO ₂ F/L Bracket	Vertical	ST-1377 & XT-1129
LO ₂ F/L Bracket & Bellows	Vertical	XT-1129 & XT-1106 from SE
LO ₂ P/L & C/T	Vertical	From SE

600 MM PHOTOS - 255 FT LVL

<u>Photo</u>	Shutter Speed	<u>Notes</u>
GO ₂ Vent Ducts	1/30	Contingency

600 MM PHOTOS - 215 FT LVL



Table 80-2 Final Inspection Team - Telephotos

Photo	Shutter Speed	<u>Notes</u>
-Y GO ₂ Seal	1/30	
-Y GO ₂ Seal -Y Bipod Ramp Jack Pad C/O's	1/30	Contingency
Jack Pad C/O's	1/4	Difficult if windy
LO ₂ F/L	1/15	
-Y Vertical Strut (Crack)	1/30	

600 MM PHOTOS - 195 FT LVL

Photo	Shutter Speed	<u>Notes</u>
-Y Bipod Ramp	1/30	Contingency

600 MM PHOTOS - 135 FT LVL

<u>Photo</u>	Shutter Speed	<u>Notes</u>
LH ₂ UMB	1/30	
-Y Vertical Strut (Crack)	1/60	
LO ₂ F/L Bellows	1/15	Contingency

600 MM PHOTOS - MLP

Table 80-2 Final Inspection Team - Telephotos

Photo	Shutter Speed	Notes
LH ₂ UMB	1/30	From West
LAZ UMB	1/30	From NW
LH₂ VMB	1/30	From East
LH ₂ UMB Actuator C/O	1/15 or 1/30	From North standing next to water pipe
LO ₂ UMB	1/5	Lower Inboard
LO ₂ UMB	1/8	Inboard
LO ₂ F/L Bracket & Bellows	1/15	One photo to include XT-1978 & XT-1973
LO ₂ F/L Bracket	1/15	XT-1871
LO ₂ F/L Bracket	1/15	XT-1623
LO ₂ F/L Bracket	1/15	XT-1377
LO ₂ F/L Bracket	N30	One photo to include XT-1129 & XT-1106
LO ₂ F/L Bracket	1/30	From SE corner; One photo to include XT-1129 & XT-1106
Jack Pad C/O's	1/15	From SE corner
Ice Frost Ramps or Pal Ramps	1/15 or 1/30	Contingency
LH ₂ UMB Inboard	1/15	From East
+Y Longeron	1/15 or 1/30	Contingency
-Y Longeron	1/15	Contingency

WIDE ANGLE PHOTOS - 255 FT LVL

Table 80-2 Final Inspection Team - Telephotos

Photo	<u>Camera</u> <u>Orientation</u>	<u>Lens</u>	Notes
LO ₂ Tank	Vertical	35-70 mm	
GO ₂ Vent Ducts	Horizontal	35-70 mm	

WIDE ANGLE PHOTOS - 215 FT LVL

Photo	Camera Orientation	Lens	<u>Notes</u>
Overall GH ₂ Vent Line	Horizontal	35-70 mm	
Orbiter Nose, ET -Y Side	Horizontal	35-70 mm	
Orbiter Nose, ET -Y, +Z Side	Horizontal	35-70 mm	From RSS
Forward Half of Vehicle	Vertical	28 mm	From RSS
Entire Orbiter	Vertical	28 mm	From RSS

WIDE ANGLE PHOTOS - 195 FT LVL

Photo	Camera Orientation	Lens	Notes
Aft Part of SSV, LH Wing	Vertical	35-70 mm	
Orbiter Fwd Section, Upper LH ₂ Tank	Vertical	35-70 mm	
Bipod, -Y, +Z Intertank Area	Horizontal	35-70 mm	

WIDE ANGLE PHOTOS - 135 FT LVL

Photo Camera Lens Notes

Table 80-2 Final Inspection Team - Telephotos
<u>Orientation</u>

Orbiter Aft Section	Vertical	35-70 mm
Dower LH ₂ Tank & LH SRB	Vertical	35-70 mm

WIDE ANGLE PHOTOS - MLP

Camera Orientation	<u>Lens</u>	Notes
Vertical	28 mm	
Horizontal	35-70 mm	
Horizontal	35-70 mm	
Horizontal	35-70 mm	
Horizontal	35-70 mm	
Horizontal	35-70 mm	
Horizontal	50 mm	-Y Side
Horizontal	50 mm	
Horizontal	50 mm	
Horizontal	50 mm	
Horizontal	50 mm	+Y Side
Horizontal	35-70 mm	
Horizontal	35-70 mm	
Horizontal	28 mm	From under ET
	Orientation Vertical Vertical Vertical Vertical Vertical Vertical Horizontal	OrientationVertical28 mmVertical28 mmVertical28 mmVertical28 mmVertical28 mmHorizontal35-70 mmHorizontal35-70 mmHorizontal35-70 mmHorizontal50 mmHorizontal50 mmHorizontal50 mmHorizontal50 mmHorizontal50 mmHorizontal50 mmHorizontal50 mmHorizontal50 mmHorizontal50 mmHorizontal35-70 mmHorizontal35-70 mm



Table 80-2 Final Inspection Team - Telephotos Lower Surface

*** End of Table 80-2 Final Inspection Team - Telephotos ***

Table 80-3 Reduced Final Inspection Team Photos

WIDE ANGLE & TELEPHOTO PHOTOGRAPHY - 255 FT LVL

Photo	Camera Orientation	Lens	Notes
GO ₂ Vent Ducts	TELE	Horizontal	

WIDE ANGLE & TELEPHOTO PHOTOGRAPHY - 215 FT LVL

Photo	Camera Orientation	<u>Lens</u>	<u>Notes</u>
-Y Bipod Ramp	Horizontal	TELE	From RSS
LO ₂ P/L Ice/Frost Ramps	Vertical	TELE	From RSS; 2 photos required
GO ₂ Seal/Hood	Horizontal	TELE	From RSS
GUCP	Vertical	TELE	
Fwd Half of SSV	Vertical	28 mm	From RSS
Entire Orbiter	Vertical	28 mm	From RSS

WIDE ANGLE & TELEPHOTO PHOTOGRAPHY - 195 FT LVL

Photo	Camera Orientation	Lens	<u>Notes</u>
-Y Bipod Ramp & Jack Pad C/O's	Horizontal	TELE	

WIDE ANGLE & TELEPHOTO PHOTOGRAPHY - 135 FT LVL



Table 80-3 Reduced Final Inspection Team Photos

Photo	Camera Orientation	<u>Lens</u>	Notes
LH ₂ UMB	Horizontal	TELE	
Orbiter Aft Section	Vertical	35-70 mm	

WIDE ANGLE & TELEPHOTO PHOTOGRAPHY - MLP DECK

Photo	Camera Orientation	<u>Lens</u>	<u>Notes</u>
LH ₂ UMB	Horizontal	TELE	From West
ET Aft Dome	Horizontal	TELE	
Aft Hard Point Closeout	Vertical	TELE	
LH ₂ Tank	Horizontal	TELE	From North
LO ₂ Tank	Horizontal	TELE	From North
LO ₂ Tank	Horizontal	\TELE	From East
LO ₂ F/L Bracket Bellows	Horizontal	TELE	XT - 1978 & XT - 1973
LO ₂ F/L Bracket	Horizontal	TELE	XT - 1871
LO ₂ F/L Bracket	Horizontal	TELE	XT - 1623
LO ₂ F/L Brackets	Horizontal	TELE	XT - 1377 & XT - 1129
LO ₂ F/L Brackets & Bellows	Horizontal	TELE	XT - 1129 & XT - 1108; from SE
LO ₂ P/L & C/T	Horizontal	TELE	From SE
Overall Orbiter Left Side	Vertical	28 mm	
ET -Z Side	Vertical	28 mm	
Overall Orbiter Right Side	Vertical	28 mm	
Overall SSME Cluster -Y Side	Horizontal	28 mm	
Overall SSME Cluster +Y Side	Horizontal	28 mm	

Table 80-3 Reduced Final Inspection Team Photos

ET/Orb UMB & Orbiter

Horizontal

28 mm

From under ET

Lower Surface

*** End of Table 80-3 - Reduced Final Inspection Team Photos ***

*** End of Operation 80 ***

OPERATION 90 LO₂/LH₂ Drain Monitoring

Shop: SE

Cntrl Rm Console: FR2

OPR: ETM Zone: NA

Hazard (Y/N): N Duration (Hrs): 4.0

NOTE

This operation is contingent upon progression of launch countdown and is performed after start of cryo (LO₂/LH₂) loading and subsequent launch scrub, FRF, or WCDDT.

Operation Not Performed:

NOTE

This operation monitors the External Tank external surfaces during LO_2/LH_2 drain operations from time of detanking until 1.5 hours after LO_2/LH_2 low level sensors read dry via OTV 004/104, 009/109, 013/113, 033/133, 042/142, 054/154, 055/155, 056/156, 060/160, 061/161, 062/162, 063/163, 064/164, 065/165, 066/166, 067/167, 068/168, 069/169, 070/170, and 071/171.

Noted requirements satisfied by this operation: OMRS S00E00.021

90-1 Record start date/time (GMT) of LH₂ and LO₂ Tank Drain.

LH₂ Drain Start Date N Time N GMT

LO₂ Drain Start Date N Time N GMT

ETM N Date N

90-2	CVM1	JTV1	223		
	low level s Line, LH ₂ covers, LF	sensors rea Feed Line I ₂ /LO ₂ Um	nd dry, monitor ET ex , LH ₂ Recirculation Li	nk Drain until respective I ternal surfaces including I ne, LH ₂ Aft Dome and mand the Dome and the Dome and callowed.	LO ₂ Feed anhole
			ETM	Date	
	Support:	СОММ			
90-3	Record da	ate/time (C	GMT) when LO ₂ /LH ₂ le	ow level sensors read dry.	
	\	LH ₂	Sensors Dry Date _	Time	GМТ
		LQ2	Sensors Dry Date _	Time	GM1
		·	ETM	Date_	

90-4	CVM1	JTV1	223			
	Recircula TSM LH level sens	tion Line, ₂ /LO ₂ Umb sors have r	LH ₂ Aft Don bilicals via O' ead dry. No	ne and manhol IV cameras fo cryogenic liqu	eed Line, LH ₂ Feed I le covers, LH ₂ /LO ₂ I or 1.5 hours after LO aid or excessive vapo toring complete.	Jmbilicals, 2/LH2 low
		L	H ₂ Complete	Date	Time	GM7
		L	O ₂ Complete	Date	Time	GM7
			ETI	М	Date_	
	Support:	COMM				
90-5	Completi	on of this	operation sati	sfies noted rec	quirements.	
3.2.3 32.3	OMRSD	S00E00.0	21			
90-6	Operation	1 - LO ₂ /LH	I₂ Drain Mon	itoring comple	ete.	
		×	*** End of O	oeration 90 **	*	

OPERATION 100 Console Securing

Shop: SE

Cntrl Rm Console: FR2

OPR: ETM Zone: NA

Hazard (Y/N): N
Duration (Hrs): 0.5

100-1

CTIF TBC 136 TBC CTC 232

OTV support for ET thermal protection system evaluation no longer required.

100-2

CTIF JYVR 138

Perform the following:

- 1. Turn off video recorders.
- 2. Remove tape cartridges.
- 3. OTV support no longer required.

Support: COMM

100-3

CTIF CVM1 222 CVM2

Secure consoles by setting all monitors to "Off" position. **Report** completion.

	NOTE
Perform next step only after a su	ccessful launch.

100-4

CTIF

Remove photo processing laptop computer from Firing Room.

Not Performed: [ET]

100-5

CTIF TBC 136 TBC CTC 232

Firing Room 2, ice frost monitoring area securing complete.

100-6

Operation 100 - Console Securing complete.

ETM Date 11/29 01

*** End of Operation 100 ***

OPERATION 110 Summary Tape

Shop: SE

Cntrl Rm Console: FR2

OPR: ETM Zone: NA

Hazard (Y/N): N

Duration (Hrs): 18.0

NOTE

THIS OPERATION MAY PERFORMED IF CHIL

INITIATED.

Observations/concerns observed during count are typically recorded on the summary tape real-time (trouble tape).

110-1 CICE

After launch or launch scrub, prepare a summary tape to include observations/concerns noted during count.

110-2 Operation Summary Tape complete.

*** End of Operation 110 ***

OPERATION 120 Post Drain Walkdown

Shop: SE

Cntrl Rm Console: NA

OPR: ETM
Zone: PAD A/B
Hazard (Y/N): Y
Duration (Hrs): 2.0

NOTE

Post drain walkdown performed only after start of cryo (LH₂/LO₂) loading and subsequent launch scrub.

Operation Not Performed:

WARNING

Personnel working at heights greater than 4 feet and within 6 feet of an unguarded edge shall wear a safety harness with a lanyard secured to an approved tie off point, substantial structural member (no handrails) or a properly installed life line.

Personnel shall wear hardhats and flame retardant coveralls while performing post drain walkdown.

NOTE

Post drain walkdown typically commences approximately 1.5 hours after LH_2/LO_2 low level sensors read dry.

Post drain walkdown performed in support of a 24 hour scrub turnaround is typically coincident with the L-20 hour pre-launch walkdown for the ensuing launch attempt.

NOTE

NASA ET Mechanical Engineer (PH-H) or designee shall function as team leader. Following personnel are walkdown optional participants:

NASA Engr (4)
SFOC Engr (2)
LMSSC-LSS (1)
Boeing LSS (1)
SFOC Safety (1)

120-1 NASA Lead ET Mechanical Systems Engineer (PH-H) verify essential personnel on station, properly attired, and ready to proceed with post drain walkdown.

Essential Personnel	
NASA Engineering (PH-H)	1
SPOC Engineering (ETM)	1

NOTE

"Hands-on Investigation" is applicable only to those areas which are not understood or fully defined and which cannot be adequately evaluated otherwise.

120-2 Perform post drain walkdown as follows:

- 1. Visually inspect ET TPS exterior surfaces after detanking and warm-up (approximately T + 4 hours after drain is initiated) from the MLP, FSS, and RSS as access permiss.
- 2. Perform hands-on investigation of all areas suspected of violating Doc: NSTS 08303 (LI) NSTS PROGRAM ICE/DEBRIS INSPECTION CRITERIA (LI)





120-3	Walkdown complete. continue.	All discrepancies identified.	. No constraints to
		РН-Н	Date
		ETM	Date

120-4 Operation Post Drain Walkdown complete.

*** End of Operation 120 ***

OPERATION 130 Post Launch Walkdown

Shop: SE

Cntrl Rm Console: NA

OPR: ETM
Zone: PAD A/B
Hazard (Y/N): Y
Duration (Hrs): 3.0

NOTE

Do not perform this operation after launch scrub.

Operation Not Performed:

11/29/01

WARNING

Personnel working at heights greater than 4 feet and within 6 feet of an unguarded edge shall wear a safety harness with a lanyard secured to an approved tie off point, substantial structural member (no handrails) or a properly installed life line.

Personnel participating in walkdown shall wear hardhats and flame retardant coveralls.

NOTE

NASA ET Mechanical Engineer (PH-H) or designee shall function as team leader. Following personnel are walkdown optional participants:

NASA Engr (3)
SFOC Engr (2)
LMSSC-LSS (1)
Boeing LSS (2)
SRB ELE (1)
Thiokol-LSS (1)
SFOC Safety (1)



NASA (PH-H) **verify** following personnel on station, properly attired, and ready to proceed with post launch walkdown.

Essential Personnel				
NASA	PH-H	1		
SFOC	ETM	1		

NOTE

Post Naunch Walkdown must be performed prior to washdown and Pad being opened for normal work.

- 130-2 Perform Post Launch Walkdown as follows:
 - 1. Ref Table 130-1, visually inspect post launch pad/area to identify any lost flight or ground systems hardware and debris sources.
 - 2. Ref Table 130-2, document/SIMS photograph launch PAD area configuration.

Description: Post Daunch Walkdown



OMRSD S00U00.010-

130-3 Walkdown complete. Debris sources and lost flight hardware identified. No constraints to continue.

PH-H	Date	
ETM _	Date	

130-4 Operation - Post Launch Walkdown complete.



Table 130-1 Post Launch Walkdo	wn Inspection Areas				
Record mission info, PAD, date, ar	ıd time:				
STS	PAD				
Date	Time				
SRB Hold-down posts (HDP)					
Inspect for damage, stud hang-up Epon shim material, ordnance fragments, doghouse blast covers, erosion, missing hardware, debris. Record Results:					
MLP Deck					
SRB aft skirt purge lines SRB T-0 umbilicals Tail service masts (TSM's) MLP deck					
195 Ft Level					
Orbiter access arm (OAA)					



Table 130-1 Post Launch Walkdown Inspection Areas

215 Ft Level - GH2 Vent Line/GUCP

Latch position
Loose cables
Damage from SRB plume
Damage to the QD

255 Ft Level - GO₂ Vent Arm, Ducts, Hood

Seals
Hood windows, doors, latches

Fixed Service Structure (FSS)

Cable tray covers
Signs
Hydraulic leaks
Slidewire baskets

PAD Apron/Acreage

Vehicle hardware and/or flight TPS materials Facility debris

Table K-1 PAD Apron/Acreage Items

Location

*** End of Table 130-1 - Post Launch Walkdown Inspection Areas ***

Table 130-2 Post Launch Photos (MLP, FSS, PAD, Apron, Pad Acreage)

MLP 0-level

1 E&HDP No. 1, 2, 5 & 6 (HDP shoe and Epon shim)

1 Ea NDP No. 3, 4, 7 & 8 (blast cover down to HDP base)

1 Ea SRB T-O umbilical

1 Ea overall view SRB exhaust cutouts\

Any unusual or debris-related damage to the facility; sound suppression water pipes, TSM's cracks in MLP deck, witness panels, handrails, etc.

Any flight hardware debris (tiles, SRB ordnance fragments) Any facility debris (nuts, bolts, cable tray covers, etc.)

FSS

Close-ups of GUCP and latching mechanism Overall views of GO₂ vent hood/ducts, if damaged Any flight hardware or facility debris Any unusual or debris-related damage to the facility

PAD Apron/PAD Acreage

Any flight hardware or unusual facility debris objects

Any unusual or debris-related damage to the PAD (such as missing brick in the flame trench), perimeter fence, etc.

*** End of Table 130-2 - Post Launch Photos (MLP, FSS, PAD, Apron, Pad Acreage) ***

*** End of Operation 130 ***

OPERATION 140 Film Review

Shop: SE

Cntrl Rm Console: NA

OPR: ETM Zone: NA

Hazard (Y/N): N Duration (Hrs): 15.0

NOTE

This operation may be not performed after launch scrub.

Operation 140 Not Performed: 129 0

NOTE

Analysis of Pad Debris Inspection Results determines priority for film review. All critical film (as determined by the Debris Team) must be reviewed as soon as possible after launch and no later than 36 hours prior to entry (of the Orbiter into the earth's atmosphere).

- 140-1 Review and analyze all engineering launch (and flight) film to:
 - Identify any debris damage to the SSV
 - Identify flight vehicle or ground system damage that could affect Orbiter flight operations of future SSV launches.



OMRSD S00U00.011-1

ETM N/A Date N/A

140-2 Operation - Film Review complete.

ETM NA Date NA

*** End of Operation 140 ***

OPERATION 145 IR Camera Removal

Shop: PH-H

Cntrl Rm Console: NA

OPR: ETM Zone: NA

Hazard (Y/N): N Duration (Hrs): 2.0

WARNING

Hard hats required on the Pad when SSV is not present.

CAUTION

Exercise care to avoid dropping equipment, fasteners, etc from RSS roof to prevent damage to equipment or injury to personnel. All tools must be tethered.

NOTE

IR Camera removal from RSS Roof site may be not performed in launch scrub turnaround scenarios.

145-1 Remove IR camera at RSS Roof Site as follows.

- 1. Remove fasteners (2 pl) from camera housing front. Retain fasteners for reinstallation when front cover is installed.
- 2. Install camera housing front cover using previously removed fasteners (2 pl). Tighten fasteners (2 pl) wrench tight.



WARNING

Power cable is live. Care should be exercised when connecting power cable to avoid electric shock.

CAUTION

Do NOT allow back cover to exert undue force on cables when opening/rotating back cover.

3. Rotate camera housing back cover into open position by removing bolts with flat washers (20 pl). Retain bolts/washers for reinstalllation.

4. Disconnect:

- Power cable
- Pan & tilt cable
- Controller cable
- OTV coaxial cable
- 5. Unlock spring pin at lower, left to release IR camera Unit in camera housing. Remove IR Camera Unit from camera housing by carefully sliding it out the back opening of the camera housing. Support IR Camera Unit during removal.
- 6. Rotate camera housing back cover into closed position. Do not pinch cables. Secure back cover by reinstalling bolts/flat washers (20 pl). Tighten bolts wrench tight.



WARNING

Isopropyl Alcohol is flammable and is a skin, eye and respiratory tract irritant that affects the central nervous system. Ensure adequate ventilation, avoid inhalation of vapors and do not use near heat, sparks or open flame. Skin contact may cause redness and pain eye contact will cause severe eye irritation and may result in permanent damage. Inhalation of vapors in high concentrations has a narcotic effect on the central nervous system. Personnel shall wear N-Dex nitril gloves and chemical splash goggles. When working at eye level or above wear a face shield over goggles.

WS002.a 05-22-01

- 7. Clean IR Camera Unit lens plate using (1) roll 8305-00-519-3144 Rymple cloth dampened with (4) ounces 6810-00-543-7915 Isopropyl alcohol.
- **8. Route** IR Camera Unit to VAB 3K1 for refurb/checkout.

NASA PH-H _	AIN	Date N/A
USA ETM _	Alm	Date NA
·		Not Performed: VIZ9/01



NOTE

IR Camera removal from Camera Site 2 may be not performed in launch scrub turnaround scenarios.

145-2 Remove IR camera from Camera Site 2 as follows.

- 1. Remove bolt(s) from camera housing front. Retain bolt(s) for reinstallation when front cover is installed.
- Install camera housing front cover using previously removed bolt(s).
 Tighten bolt(s) wrench tight.

WARNING

Power cable is live. Care should be exercised when connecting power cable to avoid electric shock.

CAUTION

Do NOT allow back cover to exert undue force on cables when opening/rotating back cover.

- 3. Loosen screws (8 pl) securing camera housing back cover using Phillips screwdriver. Rotate camera housing back cover to open position. Retain bolts/washers for reinstallation.
- 4. Disconnect:
 - Power cable
 - Pan & tilt cable
 - Controller cable (2 pl)
 - OTV coaxial cable
- 5. Unscrew set screw(s) at lower, left/right to release IR camera Unit in camera housing. Remove IR camera Unit from camera housing by carefully sliding it out the back opening of the camera housing.

 Support IR camera Unit during removal.
- 6. Coat camera housing back cover O-ring with a single coat of (1) tube/jar 6505-00-133-8025 Petroleum Jelly, Vaseline (or equivalent).

7. Rotate camera housing back cover into closed position. Do not pinch cables. Secure back cover by installing screws (8 pl). Tighten screws wrench tight using Phillips screwdriver.

WARNING

Isopropyl Alcohol is flammable and is a skin, eye and respiratory tract irritant that affects the central nervous system. Ensure adequate ventilation, avoid inhalation of vapors and do not use near heat, sparks or open flame. Skin contact may cause redness and pain eye contact will cause severe eye irritation and may result in permanent damage. Inhalation of vapors in high concentrations has a narcotic effect on the central nervous system. Personnel shall wear N-Dex nitril gloves and chemical splash goggles. When working at eye level or above wear a face shield over goggles.

WS002.a 05-22-01

- 8. Clean IR Camera Unit lens plate using (1) roll 8305-00-519-3144 Rymple cloth dampened with (4) ounces 6810-00-543-7915 Isopropyl alcohol.
- 9. Route IR Camera Unit to VAB 3K1 for refurb/checkout.

NASA PH-H _	NIA	Date NA
USA ETM _	Aln	Date NA
		Not Performed: "\z9\51

*** End of Operation 145 ***

OPERATION 150 Final Report

Shop: SE

Cntrl Rm Console: NA

OPR: ETM
Zone: NA

Hazard (Y/N): N Duration (Hrs): 0.5

NOTE

This operation may be not performed after launch scrub.

Operation 150 Not Performed:

11/29/01

Assemble final report by attaching following reports to this OMI. Reference each to this step.

Post Launch PAD Assessment SRB Assessment Launch Film Review Launch Day Video Review Orbiter Landing Assessment ET Separation Review

150-2 Final report assembly complete.

ETM NA Date NA

150-3 Operation - Final Report complete.

*** End of Operation 150 ***



* Sorted by DETECTED DURING, PR ELEM CD, and EICN * ***************************** ************************************ PROGRAM PRA120 SELECTION CRITERIA * Starting RPT DT: 11/09/01 Ending RPT 0T: 12/14/01 * DETECTED DURING: \$6444 RPT TYPE: IPR RPT STATUS: OP LRU or Non-LRU: B STS NO: PR GROUP: PR ELEM CD: PRACA EFF CD: EICN: WORK AREA CD:

PROBLEM REPORTING AND CORRETTIVE ACTION SYSTEM PROBLEMS BY DETECT RING

DATE: 12 74/01 10:47 REPORT : PRA1200A

IV-6-381703 YES S0007VL2

RPT NO: CONSTRAINTS: CONSTRAINTS TO: HAZARD OP CD: HAZARD OP: GTY/UNITS: DETECTED DURING: S6444 FILM REVIEM-STS105
WORK AREA LDC:
WORK AREA LDC:
WORK AREA ZONE:
PART PROG NO:
PART PROG NO:
PART PROG NO:
RUNCT CRIT:
HW CRIT:
SERIAL REV NO:
REPL SER NO:
FINAL ACPT DT:
TECH SAMP:
GOVT STAMP:

QTY/LINITS: 0 RPTED BY ID/NM: T08011

RPTED BY ID/NM: T08011 SEALE, RANDALL D RPT BY ORG/DEPT: USA 53910 RPTED BY PH: (\$21)861-5348 RPT DT/TH: 12/10/01 09.01

DATA CODE:
FSCH NO-NH:
NHA PN TDID:
RSPBL ORE:
RC CONSTRAINT TO:

SOFTWARE PROB DT/TM:

E

VALIDATOR ID/NM: VALIDATOR DT:

CONTR STAMP:

SYS RESTD DT: SYS REST ID/NM:

TPD CAUSE:

RC CLOSURE DT:

RC CLOSURE DT:

RC CLOSURE ID/NM:

RC CLOSURE ID/NM:

POST LAUNCH FILM ANALYSIS OF FILM E-18 SHOWS A CYLINDRICAL SHAPED OBJECT COMING INTO VIEW AT 21:10:15.643 GMT BEST ESTIMATE OF OBJECT IS THAT IT IS A 3"L X .75" DIA FACILITY BOLT

PAGE 1

ITEM 1

DESCRIPTION:

RELATED RPTS:

* TOTAL DETECTED DURINGS FOR THIS REPORT

* TOTAL ELEMENTS DETECTED BURING: \$6444 FILM REVIEW-STS105

* END OF REPORT

DEC X 201

PAGE:

000 G GSE

EICN: PADA-2209
STS EFF:
MORK UNIT CD:
ENG CHNG REQ:
MEIGHT REQ:
RETEST REQ:
TIME CYCLE:
CRIT SKILLS:
FRACTURE CRIT:

WAD NO. **DEVIATION INDEX** PERMANENT | TEMPORARY | TEMP RECYCLE S6444 REV: J CHG: (OMI) DATE/TIME: 11/16/2001 10:23:00 TASK NO./SEQ. NO. 50 SED/ STEP QC/ PP&C DATE REMARKS EFFECTIVITY 2001-04-09 CHG: 01 INC: J-02 50-01 50 8 50-01 50 19 2001-11-16 CHG: 02 5 5 g 01/05/108:1017



USA INSPECTION COPY TOP/WAD Deviation

						·			
United Space Alliance		Dev No. <u>50</u>	0-01	DILS No	927148	Page 1 of 1			
TOPWAD No.		REV/CHG/VER	In Family		Cause Code Org	Cause Code Reason			
S6444 		J02	Out of Fa	amily	(B,D,E,G,H,C,N,O,P,Q,S,T,V)	10-Tech Chg 20-Proc Chg 30-Auth Error 40-Rewrite 20			
First Use SRB 8J- ET		GSE		XSTS-	~				
Effectivity: ORB /FLT		FRCS/P	DD /FLT		SSME	/FLT			
	sign Req			PPE		nternal Review Req.			
Collinator OPR	١	Gentifactor Te	St Conductor	1061	// 4	1 PH-42			
Contractor Test Project Engineer Densen		Other	ans.	- 11/13	Gov't Project Engli	Man 1415-01			
Contractor Safety	-16-0	Other	<u>S</u> F	Check	Gpv't Jest Directo	r or Contractor Chief TC			
<u></u>		Win Ro	• -	115/01	Annie 1	me nillo			
Page Number: 50-10 Step Number: 50-19 Add Note and Step 50-19-1:									
			····						
			NOTE						
Ref: NSTS 16007 (LI) NS	TS Program	Launch Co	ommit C	riteria - Hazardoi	ıs Gas			
Subsystem Append	ix F -	Ice Launch C	Commit Cri	teria def	ines "No-Go Coi	nditions".			
Verify there are no Ice Launch Commit Criteria "No-Go Conditions" being violated. ETM: Date 11/29 01									
Reason: Provide positive verification that LCC have not been violated. INSPECTION COPY Originator (print) SPDMS ID Phone Organization Date No Perm Contract Towns									
	08011	Phone 1-3348	Organiz ETM			Perm Temn			
USA FORM 4-30A		1-0040	C IVI	1	1/14/01	Temp-Recycle			